Sanua



GENERAL CATALOG
2021-2022



Sanwa's mission

Sanwa sees its mission as contributing to global environmental conservation and energy management through continuous advances in electrical and on-site measuring instruments, while "putting the trust and satisfaction of customers first".

Contents

Digital Multimeter



PC7000.....P10 PC710.....P10 PC700.....P11 PC720M.....P11 PC773....P12 PC20....P12 CD772....P13 CD771....P13 CD770....P13 CD732....P14 RD700....P14 RD701....P14 CD800a....P14 PM3....P15 PM11 P15 PM7a.....P15 PS8a.....P15 KP1 (Volt Tester).....P16

PM33a (Hybrid DMM).....P16



EM7000.....P19 CX506a.....P19 YX-361TR.....P19 YX360TRF.....P20 SP21....P20 SP20....P20 SP-18D....P21 TA55.....P21 AP33....P21

MG5000.....P24

Insulation Resistance Tester



MG1000.....P25 MG500.....P25 HG561H......P25 M53.....P26 PDM1529S....P26 PDM5219S....P26 DM1009S....P27 DM509S.....P27 PDM509S....P27

through the utilization of high levels of quality.

Top class quality popular in 74 countries around the world.

Measurements become valid only when people place confidence in the quality of measuring instruments.

Sanwa has supported the work of professionals for 80 years and has produced a myriad of different solutions

This quality control includes not only "products", but also each and every operation, maintenance services, and




DCM60R......P31 DCM660R......P31 DCL1200R.....P32 DCL3000R (Flexible CT)....P32 DCM400....P32 DCL1000....P33 CAM600S (Analog Type).....P33 DCM600DR....P33 DCL31DR....P34 DCM2000DR....P34 DCM400AD....P34



KD3 (Voltage Detector)......P35 KS1 (3 phase Detector)......P35 KS3 (3 phase Detector).....P35 KDP10 (Voltage Detector Supporter).....P36 LX20 (Illuminance Meter)....P36 LP10 (Laser Power Meter)....P37 LCR700 (LCR Meter)....P37 SE300 (Tachometer).....P38 SE9100 (Speedometer)....P38 PDR302 (Earth Tester).....P39 PDR4000 (Earth Tester)......P39 KIT-8D (Assembly Training Kit).....P40 PC20TK (Assembly Training Kit)....P40 STD5000M (Calibrator)....P41

DCL11R.....P31

DLC460F (Leak Current)....P35



Function marks and terminology used in Sanua General Catalog

Function marks



True RMS (True root-mean-square value)

True RMS value. AC current and voltage of a non-sine wave can be measured by true RMS values.



Dual Display Allows simultaneous

reading.



Drop shock proof

furnished with a taut band and impact-resistant design enough to withstand a shock of drop.



DC / AC measurable Both ACA and DCA are



Leakage current LEAK A clamp meter that can

make the measurement of leakage current have a range to allow measurements in milliamp.



Frequency Expressed in the unit of Hz

(hertz), Commercial frequency of 50Hz/60Hz can be



Capacitor

Capacitor capacity (electrostatic capacity) is measured and expressed in the unit of F (farad), μ F, etc.



Duty cycle Duty The duty cycle of

repeating waveform is indicated on a percentage basis (%). It can be used for the analysis of control signals.



Continuity check The LED lights up when

the measuring object is electrically conducting

Continuity buzzer The buzzer sounds when

the measuring object is electrically conducting.

by running a given current



Battery check Battery voltage is measured and assessed

Temperature measurement Temperature can be measured using the optional probe



4-20mA%

4-20mA for sending instrumentation signals. Expresses the current loop of 4mA as 0% and 20mA as 100%



dBm Scaling of voltage values

is performed according to the reference impedance into dBm. Convenient for use with audio equipment.



Provided with graduations for measuring the DC current amplification factor (hFE) of a transistor.



EF function

Non contact AC voltage detection function



Capture (peak hold)

The peak value like in-rush current is indicated. The minimum pulse width capturable differs according to models



Low-pass filter

Low-pass filter cuts current value of high frequency.



Inrush

Inrush current can be measured



Zero-center meter (NULL) Moves the indicator of the

analog tester to the center of the scale (meter graduations) to make measurement of positive and negative voltage.



Automatic Measurement for DCV/ACV/Ω

Measurement function of DCV/ACV/Q can be automatically selected.



Logging The reading can be stored

in the meter itself. Polarity switch

The positive and negative polarity of the measuring terminal can be changed by this switch



Output terminal Cancels the DC current

portion of voltage mixed with DC and AC to measure the AC portion alone. It is used for the measurement of audio signals



Auto power off Power is automatically

turned off when a certain time has elapsed after power-up Some models have a function to cancel this function.



Auto power save The display disappears to

bring the device into the power-save state when a certain time has passed after power-up. Some models have a function to cancel this function



Data hold A value indicated on the

display is fixed. It is fixed even after the test lead is removed, and can be used as a record for reference purposes.

Range hold

The range is fixed in the measurement of varving voltage and current which is difficult to read in the auto range.



Measurement of REL relative value

A certain measured value is assumed as 0 and measured values after that are expressed by positive or negative values relative the value fixed as 0.



MAX / MIN / AVG

The maximum value, the minimum value and the average value are displayed or recorded. The recorded value can be seen later on the display.



Low power ohm Resistance is measured by

applying voltage of approximately 0.4V or less on a measuring object. It is characterized by the fact that the semiconductor does not conduct at approximately 0.4V or less even in forward

BACK Backlight

Allows indicator reading in a dark place.

Automatic live circuit detection

Live circuit detection prevents insulation test if the mesured object is a live circuit

Auto discharge When the measurement of

insulating resistance is complete, voltage charged in the measuring object is discharged.

USB connection Data can be outputted by

connection to the USB port of a PC.

Temperature measurement with PC Link

Temperature can be measured using the optional probe and PC Link software. (T-300PC is necessary.)

Withstand voltage

It refers to insulating withstand voltage of the measuring instrument

$\blacksquare \pm (\square \% + \square) = \pm (\square \% rdg + \square dgt)$

display. "dgt" is an abbreviation of "Digit" meaning the least unit of digital display. For instance, "±2dgt" refers to error of ±2 counts.

Correctness. JIS defines the term 'accuracy" to be used for digital testers and "tolerance' for analog testers. The accuracy /

tolerance differs depending on the

Accuracy / Tolerance

Glossarv

Auto range The range is automatically increased

or decreased in steps such as 2V/20V/200V and moves to the optimum range for measuring voltage. Bandwidth(Frequency char-

Clamp conductor size

Size of a maximum conductor shape

Clamp diameter It gives a guide for the thickness of a

clampable wire ■Display digit Maximum number of display digits of

the digital display. 1999 is expressed

as 2000. Three and a half digits and

Full scale (fs) It is the indication of tolerance expressed by percentage values relative to the full-scale value of the

current, resistance, electrostation capacity and frequency

Input resistance (Impedance) Internal resistance between

measuring terminals. For instance, it is expressed as "M Ω " with the DMM and as "K Ω/V " with the AMT Live circuit detection

four and a half digits are also used. When a test lead is set at an

insulating resistance measuring point on a measuring object, the ACV measuring status starts to check

Range

The measuring range of a function is

Resolution

the 1.999V range is 0.001V.


Scale length The tolerance in resistance measurement is expressed with

reference to the scale length of the

whether voltage is being supplied. rdg is an abbreviation of "Reading" meaning a read value on digital

Displayable minimum value of the last digit. For instance, the resolution of

sales and marketing activities, and is thoroughly implemented utilizing reliable systems and the intangible Frequency range of measurable Function sub-divided and expressed as signals in the measurement of AC Function for measuring voltage, 2V/20V/200V, etc. awareness of each of our employees. Sanwa is a Japanese name brand that lives up to the trust of engineers voltage and current. around the world through the provision of high quality measuring instruments.

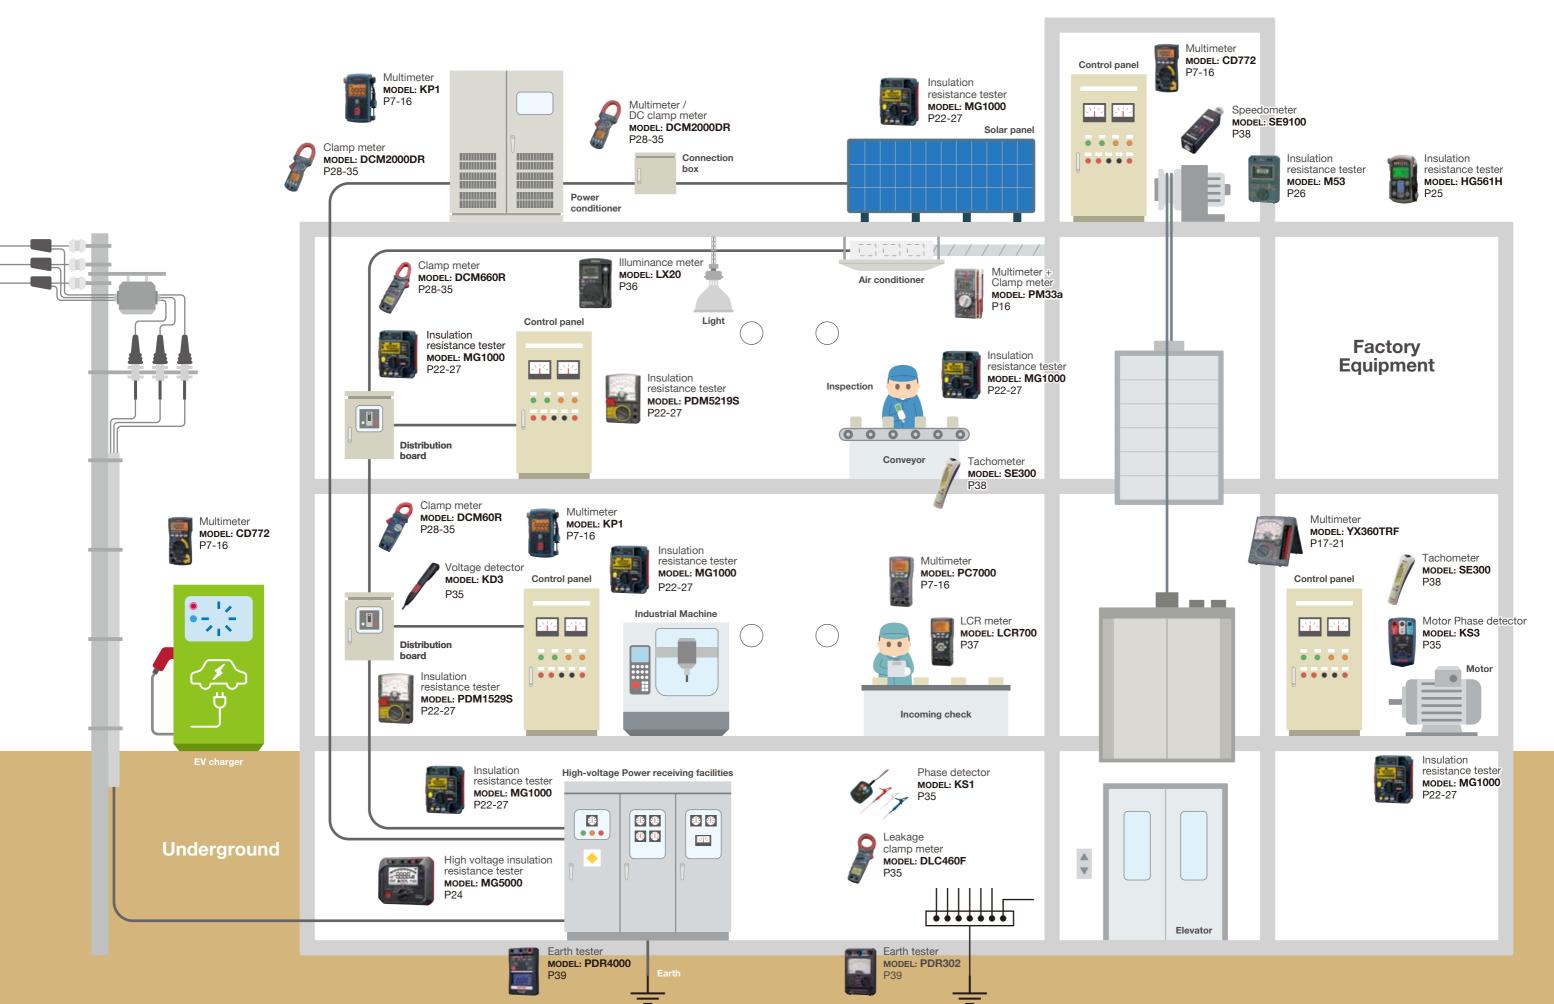

06

PC Link System

Enhanced operational efficiency by means of data retrieval software, PC Link 7, which can handle measurements for up to a maximum of 8 channels.

The PC Link system is the software dedicated to a PC for retrieving data outputted from a SANWA digital multimeter (PC series). The operation screen displays graphs in real time to allow you to check changes in measured values (voltage, current, etc.) with ease. Measured data can be saved on a CSV file, so it is easily processed on Excel. The ease of use in a variety of applications from data retrieval, processing and analysis results in its extensive acceptance for business, education and personal use.

PC Link 7 Max 8 Channels





Applicable Model

PC7000, PC720M, PC710 PC700, PC773, PC20, PC20TK

■Data acquisition screen



■Alert indication

測定道 - ALAR	м		
CHI DIO7 ACV			*
CHI Max 2099 ACV	Over-8187V	Count 1	
10:11 41 801	10.00-23.017		ij.

Highly visible alert
Send alert information by e-mails
Save them into files


Multi-window flexible screen layout (Flexible size and position of each window)



■Traditional overlapped graphs and separated graphs by each channel.
Also, easily switchable display/hide.



parated graphs



Overlapped graphs

Customizable screen

Major features:

- Automatically detects a port connected with a digital multimeter
 No additional driver installation required with Windows standard
- The retrieval interval can be set by seconds. The shortest reading interval of 0.2 0.3 seconds depending on the digital multimeter measuring function.
- Allows setting for vertical/horizontal zoom, reading at the cursor position, and Y axis split while retrieving data.
- Allows automatic retrieval by schedule setting.

- Allows data saving into CSV files and sending e-mails of alert information with alarm setting
- Allows data saving into CSV files with the date and time appended.
- Multi-window, separated graphs by each channel
- · Allows automatic e-mail of measurement data.
- Allows limited operations depending on the user with usage restriction function.
- · Allows conditional recording by event function.

PC Link 7 operating environment

OS:Windows XP (32bit) / 7 (32bit / 64bit) / 8 (32bit / 64bit) / 10 (64bit) CPU:Pentium IV 1.6GHz or better Memory:1GB or better Resolution:800×600 or above



• Microsoft and Windows are registered trademarks or brands of US Microsoft Corporation in the USA and other countries

Digital Multimeters

What is Digital Multimeter?

A digital multimeter is a convenient measuring instrument that allows by itself the measurement of DC voltage, AC voltage, DC current, AC current and resistance (Pocket type DMM normally cannot be used for the measurement of current for safety reasons). In addition to these basic measuring functions, most models are provided with features such as a diode test function and continuity buzzer. Some of recent products feature the measurement of frequency and capacitor capacity. Some have added functions of maximum and minimum value hold and relative value measurement as well as data hold and range hold functions. The PC series DMMs connect to a PC making it possible to let a PC assume the function of expensive recording meters and recorders.

Advantages of digital multimeters (DMMs)

Highly accurate measurement. Higher accuracy (1% or less) compared with an analog multimeter (approximately 3%).

Reduced measuring loss due to high internal impedance (low voltage drop between terminals).

No parallax reading error occurs as with an analog multitester.

Four key points in choosing a suitable model

1. What are the necessary measuring functions?

Choose the necessary functions, except voltage and resistance measurement. (including need for the measurement of current (400mA, 10A, 12A, 20A), capacitor, frequency, temperature and measurement of 4-20mA, etc.)

2. Other necessary functions

Functions required differ depending on where the measurement is taken.

- To record measured values concurrently with the process of measurement
- → To fix data by the data hold function.
- → To secure the test lead in the holster.
- 2) To check changes in measured values
 - → Measurement of maximum values, minimum values, and relative values.

3. For measurements of waveforms of non-sine waves, choose a model supporting measurements by RMS values.

In measuring distorted sine and non-sine waves (square wave, triangular wave, pulse), significant errors occur in measurement by models making measurements by mean values.

There are two types of RMS values.


AC-Coupled true RMS value: Adapted to measurements of distorted sine and non-sine waves of the AC AC + DC-coupled true RMS value: Adapted to measurements of waveform containing a DC component.

4. Other functions

There are other types including a function to transfer data during measurement to a PC in real time and a function to record measured data in a built-in memory. To transfer data to a PC, optional connecting cables and data retrieval software (PC Link or PC Link Plus) are required in addition to a DMM of PC series.


Measurement

Voltage, Resistance measurement

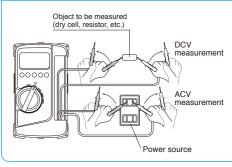


In making measurements, connect your DMM in parallel with an object to be measured. Do not apply signals exceeding the maximum rated input voltage.

Current measurement

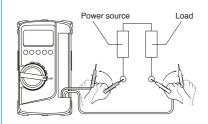

In making measurements, connect your DMM in series with an object to be measured. Do not apply signals exceeding the maximum rated input current.

Diode test

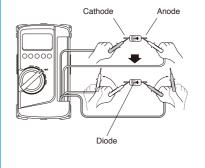

When the black test lead is connected to the cathode side of the diode and the red test lead to the anode side, the forward voltage can be measured. In contrast if the black test lead is connected to the anode side of the diode and the red test lead to the cathode side, the reverse voltage can be measured and "OL" display appears

Digital M	lultimete	r Compai	rative Cha	art					
			PC Connec	ction				Standard	
el	PC7000	PC710	PC700	PC720M	PC773	PC20	CD772	CD771	CD770
	V				With the second				
	P10	P10	P11	P11	P12	P12	P13	P13	P13
	50000	9999	9999	9999	11000	4000	4000	4000	4000
	500000 CATIII 600V	6000 CATIII 600V	6000 CATIII 600V	6000 CATIII 600V	CATIII 600V	-	CATIII 600V	CATIII 600V	-
	CATII 1000V	CATII 1000V	CATII 1000V	CATII 1000V	CATII 1000V	-	CATII 1000V	CATII 1000V	-
S (AC)	•	•	_	•	•	-	•		_
-/	A/M	A/M	A/M	A/M	A/M	A/M	A/M	A/M	A/M
nax	1000	999.9	999.9	999.9	1000	1000	1000	1000	600
max	1000	999.9	999.9	999.9	1000	750	1000	1000	600
max	10	10	10	10	11	10	15	10	400m
max	10	10	10	10	11	10	15	10	400m
nce(Ω)max	50M	60M	60M	60M	110M	40M	40M	40M	40M
st voltage	- 25m	- 05m	-	- 0Em	11000	100	100	100	100
itance (F) max	25m	25m	25m	25m	110m	100 μ	100 μ	100 μ	100 μ
rature(°C)min rature(°C)max	-50 1000	-50 1000	A	-50 1000	A	A	-20 300	-	-
ncy (Hz) min	1000	15	15	15	110	-	5	5	5
ncy (Hz) max	200k	50k	50k	50k	1.1M	-	100k	100k	100k
eq. (Hz) min	5	5	5	5	-	-	-	-	-
eq. (Hz) max	2M	1M	1M	1M	-	-	-	-	-
uity	Buzzer	Buzzer	Buzzer	Buzzer	Buzzer	Buzzer	Buzzer	Buzzer	Buzzer
					LED		LED	LED	
test	•	•	•	•	•	•	•	•	•
ycle	•	•	•	•	-	-	-	-	-
n	•	-	-	-	-	-	-	-	-
uctance tection		•	-	-	-	-	-	-	-
power off/save	Save	Save	Save	Save	Off	-	Save	Off	Off
ry check	-	-	-	-	-	-	-	1.5V	-
hold	•	•	•	•	•	•	•	•	•
ge hold	•	•	•	•	•	•	•	•	•
ak hold	•	•	-	•	-	-	-	-	-
ative value	•	•	•	•	•	-	•	•	•
0mA%	•	-	-		-	-	-	-	-
+DC	•	-	-	•	-	-	-	-	-
a logging	•	•	-	•	-	-	-	-	-
graph /Min	•		-		-	-	-	-	-
ink	•	•	•	•	•	•	-	-	-
onal AC adapter	-	-	-	-	-	•	-	-	-
nsion H (mm)	184	184	184	184	166	167	166	166	166
ension W (mm)	86	86	86	86	82	90	82	82	82
ension D (mm)	52	52	52	52	44	48	44	44	44
ass (g)	430	430	430	430	360	330	360	360	340

▲ Optional accessories are necessary.

High accuracy & high resolution (PC Link)

00

00

00

00

PC7000



500000 Count for DCV, Dual Display

■4-4 / 5digits 50000 count (Selectable 5-4 / 5 digits 500000 count for DCV) ■Dual Display shows voltage/current and its frequency, and AC components and DC components of voltage/current

■AC True RMS Low-pass filter for variable frequency drive(VFD)

 \blacksquare Current (mA / μ A) %4-20mA measurement ■Capture (peak hold) 0.8ms in duration MAX, MIN, AVG recording mode ■K type temperature -50°C ~1000°C

 **Optional accessory K-AD is necessary.
 **K type temp. sensor K-250PC is included as a standard accessory. ■ Frequency measurement (AC sine wave only) ■Logic frequency measurement, duty cycle

measurement Conductance measurement

■Dual display with backlight ■Data hold, Range hold

Relative value

Auto power saving mode (17min.) (cancelable) Optical Link USB interface (optional)

Display: numeral display 50000 & 500000 selectable, bar graph 41 segments

Sampling rate: 5 times/sec. for 50000 count, 1.25 times/sec. for 500000 count, 60 times/sec. for bar graph Safety: IEC61010-1, IEC61010-31 CAT.III 600V

Max./CAT. II 1000V Max., EN61326-1 Battery life: Approx. 100h (alkaline battery) at DCV range

RMS Hz --- (*)) °C 4-20 dBm LPF





PC7000	Measuring range	Best accuracy	Resolution	Input impedance
DCV	500m/5/50/500/1000V	± (0.03%+2)	0.01mV	10ΜΩ
ACV	500m/5/50/500/1000V	± (0.5%+40)	0.01mV	I UIVI 12
DCA	500 μ /5000 μ /50m/500m/5/10A	± (0.1%+20)	0.01 μ A	
ACA	500 μ /5000 μ /50m/500m/5/10A	± (0.6%+40)	0.01 μA	
Resistance	$500/5k/50k/500k/5M/50M\Omega/99.99nS$ *1	± (0.2%+6)	0.01 Ω	
Capacitance	50n/500n/5 μ /50 μ /500 μ /5m/25m	F± (0.8%+3)*2	0.01nF	
Temperature	-50~1000°C (thermocouple K type)	± (0.3%+2)	0.1℃	
Frequency	10Hz~200kHz	± (0.02%+4)	0.001Hz	
Logic frequency	5Hz~2MHz	± (0.002%+4)	0.001Hz	
Duty cycle	0.1%~99.99%	\pm (3d/kHz+2)	0.01%	
dBm	-29.83dBm~54.25dBm	\pm (0.25dB+2)	0.01dB	
Continuity	Buzzer sounds at between 20Ω and	d 200 Ω Open vo	oltage : belov	v 3V
Diode test	Open voltage : approx. 3V			
Bandwidth	V: 45Hz~1kHz, 1kHz~20kHz(beld	ow 500V), A : 40	Hz~1kHz	
Fuse / Battery	11A/1000V IR20kA ∮10×38 0.4A/1000V IR30kA ∮6.3×32	6LR61(9V)×1		
Size / Mass	H184×W86×D52mm/430g (includ	ing holster)		
Standard accessories included	Test Lead (TL-23a), Holster (H-700) Instruction manual), Thermocouple	K type (K-2	50PC),

*1 nS(Conductance): High-value resistance of Giga-Ohms for leakage measurer

Conductance is the inverse of Resistance, that is S=1/ Ω or nS=1/G Ω

*2 Accuracy of film capacitor or equivalent with low leakage.

Software : PC Link7 Optical PC link cable : KB-USB7

Clamp probe : CL-22AD, CL33DC, CL3000

Temperature probe : T-300PC (PC Link software is necessary.)

K-8-250~800 K type adapter : K-AD Test lead: TL-21M, TLF-120

Carrying case: C-PC7

Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4, TL-A7M, TL-A7M2

PC710



True RMS, Dual Display

frequency, and AC components and DC components of voltage/current AC True RMS

strength of electric field which surrounds

■K type temperature -50°C~1000°C

■Frequency measurement (AC sine wave only)

■Conductance measurement

seaments

Battery life: Approx. 60h (manganese battery) at DCV range



4 digits 9999 count & 3-5/6 digits 6000 count ■Dual Display shows voltage/current and its

■EF(Electric Field) Detection to indicate signal current-carrying conductors

Capture (peak hold) 1ms in duration ■MAX, MIN, AVG recording mode

Optional accessory K-AD is necessary.
 K type temp. sensor K-250PC is included as a standard accessory.

■Logic frequency measurement, duty cycle

Dual display with backlight

■Data hold, Range hold

Relative value

■ Auto power saving mode (30min.) (cancelable) Optical Link USB interface (optional)

Display: numeral display 9999 & 6000, bar graph 41

Sampling rate: 5 times/sec., 60 times/sec. for bar graph Safety: IEC61010-1, IEC61010-31 CAT.III 600V Max./CAT. II 1000V Max.EN61326-1















PC710	Measuring range	Best accuracy	Resolution	Input impedance
DCV	60m/600m/9.999/99.99/999.9V	± (0.06%+2)	0.01mV	10M O
ACV	60m/600m/9.999/99.99/999.9V	\pm (0.5%+3)	0.01mV	1 O I VI 52
DCA	600 μ/6000 μ/60m/600m/6/10A	± (0.2%+4)	0.1 μΑ	
ACA	600 μ /6000 μ /60m/600m/6/10A	± (0.6%+3)	0.1 μΑ	
Resistance	$600/6k/60k/600k/6M/60M\Omega/99.99ns$ *1	± (0.1%+3)	0.1 Ω	
Capacitance	60n/600n/6 μ /600 μ /600 μ /6m/25m	F± (0.8%+3)*2	0.01nF	
Temperature	-50~1000°C (thermocouple K type)	± (0.3%+2)	1℃	
Frequency	15Hz~50kHz	± (0.04%+4)	0.01Hz	
Logic frequency	5Hz~1MHz	± (0.03%+4)	0.001Hz	
Duty cycle	0%~100%	\pm (3d/kHz+2)	0.01%	
Continuity	Buzzer sounds at between 20Ω and	d 300 Ω Open vo	oltage : belov	v 1.2V
Diode test	Open voltage : approx. 3.5V			
Bandwidth	V: 40Hz~3kHz, 3kHz~20kHz(beld	ow 99.99V), A : 4	10Hz∼1kHz	
Fuse / Battery	11A/1000V IR20kA ∮10×38 0.4A/1000V IR30kA ∮6.3×32	6F22(9V)×1		
Size / Mass	H184×W86×D52mm/430g (includi	ing holster)		
Standard accessories included	Test Lead (TL-23a), Holster (H-700)), Thermocouple	K type (K-2	50PC),

*1 nS(Conductance): High-value resistance of Giga-Ohms for leakage measurements Conductance is the inverse of Resistance, that is $S=1/\Omega$ or $nS=1/G\Omega$

*2 Accuracy of film capacitor or equivalent with low leakage.

Software : PC Link7 Optical PC link cable: KB-USB7 Clamp probe : CL-22AD, CL33DC, CL3000

Temperature probe : T-300PC (PC Link software is necessary.) K-8-250~800

K type adapter : K-AD Test lead : TL-21M, TLF-120 Carrying case: C-PC7

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4 TL-A7M,TL-A7M2

High accuracy & high resolution (PC Link)

9999

00

PC700



Dual Display, Best Accuracy 0.06%

Maximum DC/AC voltage measurement resolution 0.01mV

frequency, and AC components and DC components of voltage/current High speed bar graph

Logic frequency measurement, duty cycle measurement

■Data hold, Range hold

Auto power saving mode (30min.) (cancelable) ■Optical Link USB interface (optional)

600V Max./CAT. II 1000V Max.EN61326-1

at DCV range





■4 digits 9999 count & 3-5/6 digits 6000 count

■Dual Display shows voltage/current and its

Frequency measurement (AC sine wave only)

Relative value

Display: numeral display 9999 & 6000, bar graph 41

Sampling rate: 5 times/sec., 60 times/sec. for bar graph Safety: IEC61010-1, IEC61010-31 CAT.III

Battery life : Approx. 60h (manganese battery)











PC700	Measuring range	Best accuracy	Resolution		
DCV	60m/600m/9.999/99.99/999.9V	± (0.06%+2)	0.01mV		
ACV	60m/600m/9.999/99.99/999.9V	± (0.5%+3)	0.01mV		
DCA	600 μ/6000 μ/60m/600m/6/10A	± (0.2%+4)	0.1 μ Α		
ACA	600 μ/6000 μ/60m/600m/6/10A	± (0.6%+3)	0.1 μ Α		
Resistance	$600/6k/60k/600k/6M/60M\Omega$	± (0.1%+3)	0.1 Ω		
Capacitance	60n/600n/6 μ/60 μ/600 μ/6m/25m	F± (0.8%+3)*	0.01nF		
Frequency	15Hz~50kHz	± (0.04%+4)	0.01Hz		
Logic frequency	5Hz~1MHz	± (0.03%+4)	0.001Hz		
Duty cycle	0%~100%	\pm (3d/kHz+2)	0.01%		
Continuity	Buzzer sounds at between 20 Ω and	d 300 Ω Open vo	oltage : belov		
Diode test	Open voltage : approx. 3.5V				
Bandwidth	V: 40Hz~3kHz, 3kHz~20kHz(beld	ow 99.99V), A : 4	40Hz∼1kHz		
C / Datter.	11A/1000V IR20kA ∮10×38	CE00/0\/\\\			
Fuse / Battery	0.4A/1000V IR30kA	6F22(9V)×1			
Size / Mass	H184×W86×D52mm/430g (includ	ing holster)			
Standard accessories	Test Lead (TL-23a), Holster (H-700)), Instruction ma	nual		

*Accuracy of film capacitor or equivalent with low leakage.

Software : PC Link7 Optical PC link cable: KB-USB7

Clamp probe : CL-22AD, CL33DC, CL3000 Temperature probe : T-300PC (PC Link software is necessary.)

K type adapter : K-AD Test lead: TL-21M, TLF-120 Carrying case: C-PC7

Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4 TL-A7M,TL-A7M2

High accuracy & built-in memory (PC Link)

 ϵ



87,328 points data logging in built-in memory ■4 digits 9999 count & 3-5/6 digits 6000 count

AC True RMS ■Dual display with backlight

Mautomatic measurement for ACV/DCV/Ω under low impedance

PC720M

High speed bar graph

■ Capacitance measurement

**Not suitable for measurement of condensers with large leak current. ■K type temperature -50°C ~1000°C *Optional accessory K-AD is necessary

※K type temp. sensor K-250PC is included as a standard accessor. ■Frequency measurement (AC sine wave only) Logic frequency measurement, duty cycle

measurement ■Conductance measurement MAX, MIN, MAX-MIN recording mode Capture (peak hold) 1ms in duration ■Data hold, Range hold

Relative value Auto power saving mode (30min.) (cancelable) Optical Link USB interface (optional)

Data Logging Mode

■87,328 data points in built-in memory (single display) 43,664 data points in built-in memory

(dual display) Selection of measurement interval 0.05s/0.1s/0.5s/1s/2s/3s/4s/5s/10s/15s/30s/ 60s/120s/180s/300s/600s

Auto-standby mode when a sampling speed of 30s or longer is selected Export logged data to PC

**Optional accessory KB-USB7 and PC Link7 are necessary.

Display: numeral display 9999 & 6000, bar graph 41 Sampling rate : 5 times/sec., 60 times/sec. for bar graph

600V Max./CAT. II 1000V Max.EN61326-1

Safety: IEC61010-1, IEC61010-31 CAT.III

RMS Hz - - - -)) C APS DATA RNG HOLD









OG ING	PC Link

PC720M	Measuring range	Best accuracy	Resolution	Input impedance
DCV	60m/600m/9.999/99.99/999.9V	± (0.06%+2)	0.01mV	10ΜΩ
ACV	60m/600m/9.999/99.99/999.9V	\pm (0.5%+3)	0.01mV	I OIVI SZ
DCA	600 μ/6000 μ/60m/600m/6/10A	± (0.2%+4)	0.1 μ Α	
ACA	600 μ/6000 μ/60m/600m/6/10A	\pm (0.6%+3)	0.1 μ Α	
Resistance	$600/6k/60k/600k/6M/60M\Omega/99.99nS*1$	± (0.1%+3)	0.1 Ω	
Capacitance	60n/600n/6 μ /60 μ /600 μ /6m/25mF	± (0.8%+3)*2	0.01nF	
Temperature	-50~1000°C (thermocouple K type)	± (0.3%+2)	1℃	
Frequency	15Hz~50kHz	± (0.04%+4)	0.01Hz	
Logic frequency	5Hz~1MHz	± (0.03%+4)	0.001Hz	
Duty cycle	0%~100%	\pm (3d/kHz+2)	0.01%	
Continuity	Buzzer sounds at between 20 Ω and	d 300 Ω Open vo	ltage : belov	v 1.2V
Diode test	Open voltage : approx. 3.5V			
Bandwidth	V: 40Hz~3kHz, 3kHz~20kHz (bel	ow 99.99V), A :	40∼1kHz	
Fuse / Battery	11A/1000V IR20kA ∮10×38 0.4A/1000V IR30kA ∮6.3×32	6LR61(9V)×1		
Size / Mass	H184×W86×D52mm/430g (includi	ng holster)		
Standard accessories	Test Lead (TL-23a), Holster (H-700)	, Thermocouple	K type (K-2	50PC),

*1 nS(Conductance): High-value resistance of Giga-Ohms for leakage measurements. Conductance is the inverse of Resistance, that is S=1/ Ω or nS=1/ $G\Omega$

*2 Accuracy of film capacitor or equivalent with low leakage.

Software : PC Link7 Optical PC link cable: KB-USB7 Clamp probe : CL-22AD, CL33DC, CL3000 Temperature probe : T-300PC (PC Link software is necessary.)

K-8-250~800 K type adapter : K-AD

Test lead : TL-21M, TLF-120 Carrying case : C-PC7

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4,TL-A7M,TL-A7M2

-

Data processing (PC Link)

PC773

PC20

Tilt stand

3-3 / 4 digits 4000 count

■Data hold / Range hold

Display: numeral display 4000

Sampling rate: 3 times / sec.

■0.5% best accuracy











A fuse of large

the safety.

breaking capacity (30kA) is

TUUU

11000 Count

Minimum resolution 0.01mV, 0.01 Ω ■4-1/2 digits 11000 count

■0.28% best accuracy ■AC True RMS

■Thermo plastic elastomer, high resistance against drop shock Maximum DC/AC 11A can be measured

■Continuity buzzer and LED ■Data hold, Range hold, Relative function

Auto power off function (30 min.) ■Optical link USB interface (optional)

Display: numeral display 11000 Sampling rate: 4 times / sec. AC frequency bandwidth : 45~100Hz(110mV range), 45~500Hz(1.1V range), 45~1kHz(11V range and avobe, ACA) Safety: IEC61010-1 (EN61010-1) CAT.III 600V Max. / CAT.II1000V Max.

AC adapter connectable for long haul measurement

Capacitance measurement *Not suitable for measurement of condensers with large leak current.

Protective holster with wall hanger and lead holder

■Safety cover for the 4 • 10A terminal

Safety cap for AC adapter terminal

■Optical link USB interface (optional)

		•••		17	UI
DATA HOLD	RNG	REL	BACK LIGHT	USB	PC L
					100

PC773	Measuring range	Best accuracy	Resolution	Input
DCV	110m/1.1/11/110/1000V	± (0.28%+2)	0.01mV	10M~
ACV	110m/1.1/11/110/1000V	± (0.7%+50)	0.01mV	$100M\Omega$
DCA	110 µ/1100 µ/11m/110m/11A	± (0.5%+4)	0.01 μ Α	
ACA	110 µ/1100 µ/11m/110m/11A	± (0.9%+20)	0.01 μ Α	
Resistance	110/1.1k/11k/110k/1.1M/11M/110MΩ	± (0.3%+6)	0.01Ω	
Capacitance	11n/110n/1.1 μ/110 μ/1.1m/11m/110mF	± (2.0%+20)	0.001nF	
Frequency	110Hz/1.1kHz/11kHz/110kHz/1.1MHz	± (0.01%+2)	0.1Hz	
Continuity	Buzzer sounds and LED lights up at less than 30	Ω Open Voltage:	approx. 0.2V	
Diode test	Open Voltage: approx. 0.2V			
Bandwidth	45Hz~100Hz(110mV range), 45Hz~500Hz(1.1V r	ange), 45Hz~1kHz	11V range and	above, ACA
Fuse / Battery	315mA/1000V, breaking capacity 30kA 12A/1000V, breaking capacity 30kA	R6×2		
Size / Mass	H166×W82×D44mm/360g			
Standard accessories	Test lead (TL-25a), Instruction manual	I		

Software: PC Link 7 (This model works with PC Link 7 only.) Clamp probe : CL-22AD, CL33DC, CL3000 Temperature probe: T-300PC (PC Link software is necessary.) Optical PC link cable : KB-USB773 Test lead : TLF-120 Carrying case : C-77, C-77H Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4 TL-A7M,TL-A7M2

400m/4/40/400/1000V

50n/500n/5 μ/50 μ/100 μF

Open voltage: approx. 1.5V

Software: PC Link 7 Optical PC link cable: KB-USB20

AC adapter : AD-71AC-2 (100V), AD-72AC (220V)

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4

Temperature probe : T-300PC (PC Link software is necessary.)

Clamp probe : CL-22AD, CL33DC, CL3000

Test lead : TL-21M, TLF-120 Carrying case : C-PC10/S or C-SP

TL-A7M,TL-A7M2

4/40/400/750V

DCV

DCA

ACA

Continuity

Diode test

Bandwidth

Size / Mass

Standard accessorie included

± (0.5%+2) 0.1mV DCV:

± (5%+6) 0.01nF

400 μ/4000 μ/40m/400m/4A/10A ± (1.5%+2) 0.1 μA ACV:

 $400 \mu/4000 \mu/400m/4A/10A$ \pm (1.8%+5) 0.1 μ A $_{10M}\sim$ 400/4k/40k/400k/4M/40M Ω \pm (1.2%+4) 0.1 Ω 11M Ω

Buzzer sounds at between $10\,\Omega$ and $120\,\Omega.$ Open voltage : approx. 0.4V

400 μ/4000 μ/40m/400m/4A/10A + (1.8%+5) 0.1 μA

40Hz~500kHz (below 500V) 40Hz~1kHz (ACA)

0.5A/250V IR1500A ϕ 5 \times 20mm 12.5A/250V IR125A ϕ 6.3 \times 32mm R6 \times 2

H167×W90×D48mm/330g (including holster)

Test lead (TL-21a), Holster (H-70), Instruction manual

CD772

True RMS new standard

Backlight & Temperature measurement 3-3/4 digits 4000 count ■AC True RMS

■Easy to read large LCD with Backlight Large breaking capacity fuse 30kA ■K-type thermocouple temperature measure ment -20°C ~300°C

■Thermo plastic elastomer, high resistance against drop shock

■Safety cap on current terminal ■Data hold, Range hold, Relative function

■Auto power off function (30min.) Maximum 20A can be measured if the measurement time is less than 10 seconds. (Take 10 minutes or

longer intervals between measurements) Display: numeral display 4000 Sampling rate: 3 times / sec.

■Continuity check, Diode test

AC frequency bandwidth: 45~500Hz (4V range), 45~1KHz (40V range and above) Safety : IEC61010-1 (EN61010-1) CAT. III 600V Max. / CAT. II DC1000V

± (0.5%+2) 0.1mV DCV: 400m/4/40/400/1000V DCV 4/40/400/1000V ± (1.2%+8) 1mV DCA $400 \,\mu/4000 \,\mu/40 \text{m}/400 \text{m}/4/15 \text{A} \pm (1.4\%+3) \,0.1 \,\mu\,\text{A}$ 400 μ/4000 μ/40m/400m/4/15A \pm (1.8%+6) 0.1 μ A 400/4k/40k/400k/4M/40MΩ ± (1.2%+5) 0.1Ω 11MΩ Resistance 50n/500n/5 μ/50 μ/100 μF 5/50/500/5 k /50k/100kHz ± (0.3%+3) 0.001Hz Temperature -20℃~300℃ ± (3%+30) 0.1℃ Buzzer sounds and LED lights up at between 0Ω and 85Ω ($\pm45\Omega$). Open voltage: approx. 0.4V Open voltage: approx. 1.5V

45~500Hz (4V range), 45~1KHz (40V range and above)

Test lead (TL-25a), Thermocouple K type (K-250CD) Instruction manual

RMS Hz H CONT. (CONT. LED (CONT. LED) °C

Fuse / Battery

Size / Mass

Clamp probe : CL-22AD, CL33DC, CL3000 HV probe : HV-60 Temperature probe : K-8-800, K-8-650, K-8-300, K-8-500, K-8-250 K type adapter : K-AD

0.5A/1000V 30kA Φ6.35×32mm

16A/1000V 30kA Φ10×38mm

H166×W82×D44mm/360g

Carrying case: C-77. C-77H

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4 TL-A7M,TL-A7M2

Test lead : TLF-120

Multifunctional new standard

A fuse of large

the safety.

breaking capacity (30kA)

used to further improve



CD771

Backlight & Cont. buzzer with LED

■3-3/4 digits 4000 count ■Easy to read large LCD with Backlight Large breaking capacity fuse 30kA ■1.5V battery check function

■Thermo plastic elastomer, high resistance against drop shock

Safety cap on current terminal ■Data hold, Range hold, Relative function

■Continuity check, Diode test Auto power off function (30min.)

Maximum 20A can be measured if the measurement time is less than 10 seconds. (Take 10 minutes or longer intervals between measurements)

Display: numeral display 4000 Sampling rate: 3 times / sec. AC frequency bandwidth: 40~400Hz (sine wave)
Safety: IEC61010-1 (EN61010-1) CAT. III 600V Max. / CAT. II DC1000V











CD771	Measuring range	Best accuracy	Resolution	Input impedance
DCV	400m/4/40/400/1000V	± (0.5%+2)	0.1mV	DCV:
ACV	4/40/400/1000V	± (1.2%+7)	1 mV	10M~ 100M O
DCA	400 μ/4000 μ/40m/400m/4/10A	± (1.4%+3)	0.1 μ Α	ACV:
ACA	400 μ/4000 μ/40m/400m/4/10A	± (1.8%+5)	0.1 μ Α	10M~
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (1.2%+5)	0.1 Ω	11ΜΩ
Capacitance	50n/500n/5 μ/50 μ/100 μF	± (5%+10)	0.01nF	
Frequency	5/50/500/5 k /50k/100kHz	± (0.3%+3)	0.001Hz	
Continuity	Buzzer sounds and LED lights up at between 0 Ω	and 85Ω ($\pm45\Omega$).	Open voltage:	approx. 0.4\
Diode test	Open voltage: approx. 1.5V			
Battery check	Approximate value (30 Ω load) 1.5V batt	ery only		
Bandwidth	40~400Hz (sine wave)			
Fuse / Battery	0.5A/1000V 30kA Φ6.35×32mm 10A/1000V 30kA Φ10×38mm	R6P×2		
Size / Mass	H166×W82×D44mm/360g			
Standard accessories included	Test lead (TL-23a), Instruction manua	ı		

Clamp probe : CL-22AD, CL33DC, CL3000 Carrying case: C-77, C-77H

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4 TL-A7M.TL-A7M2

Test lead: TL-21M, TLF-120

Standard type

A fuse of large

breaking capacity (30kA)

used to further improve



CD770

Easy to read large LCD ■Thermo plastic elastomer, high resistance against drop shock

Safety cap on current terminal ■Data hold, Range hold, Relative function

Continuity check, Diode test Auto power off function (30min.)

Display: numeral display 4000











New Standard

■3-3/4 digits 4000 count

Sampling rate: 3 times / sec. AC frequency bandwidth: 40~400Hz (sine wave)

CD770	Measuring range	Best accuracy	Resolution	Input impedance
DCV	400m/4/40/400/600V	± (0.5%+2)	0.1mV	DCV:
ACV	4/40/400/600V	± (1.2%+7)	1 mV	10M~ 100MΩ
DCA	400 μ/4000 μ/40m/400mA	± (1.4%+3)	0.1 μ Α	ACV:
ACA	400 μ/4000 μ/40m/400mA	± (1.8%+5)	0.1 μ Α	10M~
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (1.2%+5)	0.1 Ω	11ΜΩ
Capacitance	50n/500n/5 μ /50 μ /100 μ F	± (5%+10)	0.01nF	
Frequency	5/50/500/5k/50k/100kHz	± (0.3%+3)	0.001Hz	
Continuity	Buzzer sounds at between 0Ω and 85Ω	$(\pm 45\Omega)$. Open	ı voltage: ap	oprox. 0.4\
Diode test	Open voltage: approx. 1.5V			
Bandwidth	40~400Hz (sine wave)			
Fuse / Battery	0.5A/250V 1.5kA Φ5×20mm	R6P×2		
Size / Mass	H166×W82×D44mm/340a			

Clamp probe : CL-22AD, CL33DC, CL3000 Carrying case: C-77, C-77H

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4 TL-A7M,TL-A7M2

Test lead (TL-21a), Instruction manual

Test lead : TL-21M, TLF-120

www.sanwa-meter.co.jp

www.sanwa-meter.co.jp

13

Multifunction



CD732

High-speed bar	graph &	Cont.	buzzer	with	LED

6000 count ■Using fire-retarding materials for holster and circuit board ■Wide-range capacitance measurement (0.01nF to 3999 μF) Data hold / Range hold

■Safety cap on 6 • 15A terminal Protective holster with wall hanger and lead holder

■Auto Power Save (16min.) (cancelable)

Display: numeral display 6000, bar graph 61 segments Sampling rate: 3 times/sec.,

30 times/sec., for bar graph Safety: EN61010-1, EN61010-2-030, EN61010-2-033 CAT.III 600V / CATII DC1000V • AC750V IEC61010-031

APS DATA RNG HOLD

CD732	Measuring range	Best accuracy	Resolution	impedance
DCV	600m/6/60/600/1000V	±(0.5%+2)	0.1mV	DCV:
ACV	6/60/600/750V	±(1.2%+5)	0.001V	10M~ 100MΩ
DCA	600 μ/6000 μ/60m/600m/6/15A	\pm (1.5%+3)	0.1 μ Α	ACV:
ACA	600 μ/6000 μ/60m/600m/6/15A	±(1.8%+5)	0.1 μ A	10M~
Resistance	$600/6k/60k/600k/6M/60M\Omega$	±(1.2%+4)	0.1 Ω	11MΩ
Capacitance	40n/400n/4 μ /40 μ /400 μ /4000 μ F	±(5.0%+6)	0.01nF	
Frequency	9.999/99.99/999.9/9.999k/99.99kHz	\pm (0.5%+3)		
Duty cycle	20~80%	$\pm (0.5\%+5)$		
Duty cycle Continuity	20~80% Buzzer sounds and LED lights up at betwee	. ,	n voltage : ap	prox. 0.63\
		. ,	n voltage : ap	oprox. 0.63\
Continuity	Buzzer sounds and LED lights up at betwee	. ,	n voltage : ap	oprox. 0.63\
Continuity Diode test	Buzzer sounds and LED lights up at betwee Open voltage : approx. 2.7V	. ,	n voltage : ap	oprox. 0.63\
Continuity Diode test Bandwidth	Buzzer sounds and LED lights up at betwee Open voltage : approx. 2.7V 45~500Hz 0.4A/1000V 30kA \$\displays 6.3X32mm	n 10~60 Ω Oper R6(1.5V) X 2	n voltage : ap	oprox. 0.63\

Clamp probe : CL-22AD, CL3000, CL33DC

Carrying case : C-SP

DCV

Resistance

Capacitance

Frequency

Continuity

Diode Test

Bandwidth

Fuse / Battery

HV probe: HV-60

K type adapter : K-AD

Size / Mass

Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4, TL-A7M,TL-A7M2

 $400 \,\mu/4000 \,\mu/40 \,m/400 \,m/4/10 \,A \qquad \pm (1.2\% + 3) \quad 0.1 \,\mu\,A$

 $400 \,\mu/4000 \,\mu/40 \,m/400 \,m/4/10 \,A \qquad \pm \,(1.5\% + 4) \quad 0.1 \,\mu\,A$

400/4k/40k/400k/4M/40MO + (0.6%+4) 0.10

H179×W87×D55mm/460g (including holster)

Temperature probe : K-8-800, K-8-650, K-8-300, K-8-500, K-8-250

Buzzer sounds at between $20\,\Omega$ and $120\,\Omega$. Open voltage : approx. 0.4V

Test Lead (TL-23a), Thermocouple K type (K-250PC), Holster (H-50),

± (0.3%+4) 0.1mV

± (1.5%+5) 0.1mV

± (2.5%+6) 0.1nF

± (0.5%+4) 0.01Hz

Hz -|- •))) °C AP

400m/4/40/400/1000V

500n/5 μ/50 μ/500 μ/3000 μF

50/500/5k/50k/500k/1MHz

Open voltage : approx. 1.6V

400m/4/40/400/1000V

-20℃~300℃

50~500Hz

Clamp probe : CL-22AD, CL33DC, CL3000

HV probe : HV-60



■3-3 / 4 digits 4000 count ■0.3% best accuracy

Capacitance measurement

Not suitable for measurement of condensers with large leak

K type temperature

*Optional accessory K-AD is necessary.

*K type temp. sensor K-250PC is included as a standard accessory

accessory

Frequency measurement

#input voltage: 20VACrms and under
#input signal: sign wave or square wave with 40%-70% duty
#input sensitivity: 10Hz~20kHz/0.9Vrms and above
: 20kHz~50kHz/2.8Vp or 1.9Vrms and bove
: 500kHz~1MHz/4.2Vp or 3Vrms and above

Max recording measurement Data hold / Range hold

Auto power off (30min.) (cancelable) Alarm for improper test lead insertion to current

holder

Tilt stand

Display: numeral display 4000 (Hz: 9999, capacitance: 5000)

Sampling rate: 3 times / sec. (Hz: 2 times / sec.)

RD700 RD701

■Protective holster with wall hanger and lead

AC frequency bandwidth: 50~500Hz

High input impedance 1000M Ω

■AC True RMS **RD701 only

■ADP function (for current sensor)

Relative value

Test lead : TL-21M, TLF-120 Carrying case: C-CD Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC, TL-A4, TL-A7M, TL-A7M2

Pocket-size



4000

PM3

8.5mm thick body with multi-function

■3-3 / 4 digits 4000 count

Relative value

■0.7% best accuracy

■ Capacitance measurement

※Not suitable for measurement of condensers with large leak current. Frequency measurement (AC sine wave only)

Duty cycle ■Data hold

Auto power off (15min.) (cancelable)

Display: numeral display 4000 Sampling rate: 3 times / sec. AC frequency bandwidth : 40~400Hz Safety: IEC61010-1 CAT. II DC AC500V Max.


400m/4/40/400/500V DCV 4/40/400/500V

40~400Hz







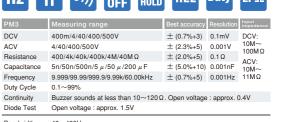

Standard accessories included Case holder (C-PM3), Instruction manual

Open voltage : approx. 1.5V

Coin type lithium battery CR2032 (3V)×1

H108×W56×D11.5mm/approx. 85g

Optional accessories

Adapter : CL-13a, CL-15a

PM11

(€

Tough but compact DMM

■3-3 / 4 digits 4000 count

■0.8% best accuracy Analog bar graph

atop the case.

Compact storage of test leads Test lead can be snapped into a fixed position

Display: numeral display 4000, bar graph 40 segments Sampling rate: 1.3 times / sec., 13 times / sec. for bar graph

AC frequency bandwidth: 45~1kHz Safety: IEC61010-1 CAT. III 300V Max. / CAT. II 500V Max.



Duty Cycle

Continuity

Diode Test

Bandwidth

Battery



PM11	Measuring range	Best accuracy	Resolution	Input impedance
DCV	400m/4/40/400/500V	± (0.8%+4)	0.1mV	DCV:
ACV	4/40/400/500V	± (2.3%+8)	0.001V	10M~ 100M O
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (2.0%+4)	0.1 Ω	ACV:
Continuity	Buzzer sounds at less than 35 $\ensuremath{\Omega}$. Ope	n voltage : app	rox. 1.2V	10M~
Diode test	Open voltage : approx. 3V			11ΜΩ
Bandwidth	45∼1kHz			
Battery	Button battery LR-44×2			
Size / Mass	H117×W76×D18mm/approx. 117g			
Standard	Instruction manual			

Adapter : CL-15a, CL-DG3a

ϵ



PM7a

Updated longtime seller

■3-3 / 4 digits 4000 count ■0.7% best accuracy Range hold Auto power off (15min.)

Low power ohm (input voltage 0.4V) at continuity range Power saving design

Display: numeral display 4000 Sampling rate: 3 times / sec. AC frequency bandwidth: 40~400Hz







РМ7а	Measuring range	Best accuracy	Resolution	Input impedance
DCV	400m/4/40/400/500V	± (0.7%+3)	0.1mV	DCV:
ACV	4/40/400/500V	± (2.3%+5)	0.001V	10M~ 100M O
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (2.0%+5)	0.1 Ω	ACV:
Continuity	Buzzer sounds at less than 10 \sim 120 Ω	. Open voltage	: 0.4V	10M~
Diode test	Open voltage : approx. 1.5V			11ΜΩ
Bandwidth	40~400Hz			
Battery	Button battery LR-44×2			
Size / Mass	H115×W57×D18mm/approx. 85g			
Standard accessories included	Instruction manual			

Optional accessories

Adapter : CL-14, CL-15a



PS8a

Solar charge battery DMM ■3-3 / 4 digits 4000 count

■0.7% best accuracy Range hold Auto power off (15min.) Low power ohm (input voltage 0.4V) at continuity range ■Power saving design

Display: numeral display 4000 Sampling rate: 3 times / sec. AC frequency bandwidth: 40~400Hz







PS8a	Measuring range	Best accuracy	Resolution	Input impedance
DCV	400m/4/40/400/500V	± (0.7%+3)	0.1mV	DCV:
ACV	4/40/400/500V	± (2.3%+5)	0.001V	10M~ 100M O
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (2.0%+5)	0.1 Ω	ACV:
Continuity	Buzzer sounds at less than 10~120 Ω	. Open voltage	: 0.4V	10M~
Diode test	Open voltage : approx. 1.5V			11ΜΩ
Bandwidth	40~400Hz			
Bandwidth Battery	40~400Hz Amorphous solar battery + manganes	e dioxide lithiun	n secondar	y battery
		e dioxide lithiun	n secondar	y battery
Battery	Amorphous solar battery + manganes	e dioxide lithiun	n secondar	y battery

Adapter: CL-14, CL-15a

All-in-one

RD700



Tough body cover

■0.7% best accuracy

*Not suitable for measurement of condensers with large leak curren Frequency measurement (AC sine wave only)

■Data hold / Range hold Relative value Auto power off (30min.) (cancelable)

used as a tilt stand

Display: numeral display 4000 Sampling rate: 3 times / sec.



CD800a

■3-3 / 4 digits 4000 count

Capacitance measurement

Low power ohm (input voltage 0.4V) at continuity range Solid & protective body cover that can also be

■Chip holder behind the body cover

AC frequency bandwidth: 40~400Hz











UFF	HOLD
LPΩ	

DCV	400m/4/40/400/600V	± (0.7%+3)	0.1mV	DCV:
ACV	4/40/400/600V	± (1.6%+5)	0.001V	10M~
DCA	40m/400mA	± (2.2%+5)	0.01mA	100M
ACA	40m/400mA	± (2.8%+5)	0.01mA	ACV: 10M~
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (1.2%+5)	0.1 Ω	11M C
Capacitance	50n/500n/5 μ/50 μ/100 μF	± (5%+10)	0.01nF	
Frequency	5Hz~100kHz	± (0.5%+3)		
Duty cycle	20%~80%	± (0.5%+5)		
Continuity	Buzzer sounds at between 10Ω and 1	20 Ω. Open vo	ltage : app	rox. 0.4
Diode test	Open voltage : approx. 1.5V			
Bandwidth	40~400Hz			
Fuse / Battery	0.5A/250V 1.5kA ∮ 5.2×20 ceramic	R6P×2		
Sizo / Macc	H176 V W104 V D46mm/approx 240a			

Adapter: CL-14, CL-15a, CL-DG3a, TL-9IC

Volt Tester



KP1

CAT.IV Volt tester

■AC True RMS

Self test - checking failures of LCD. disconnection of a lead wire

■EF (Electric Field) detection ■LCD with backlight & LED light for dark

Auto data hold

Auto power off (1min.)

Display: numeral display 9999 Sampling rate: 6 times / sec. (ACV), 5 times / sec. (DCV) Safety: IEC61010-1, IEC61010-2-030 CAT.IV600V / CAT.III1000V, IEC61010-2-33, IEC61010-31

DCV	5~999.9V	$\pm (0.7\%+5)$	0.1V
ACV	5~999.9V	±(1.7%+5)	0.1V
Continuity	Buzzer sounds at between $20k\Omega$ and	500k Ω Open voltage	: approx. 0.6V
EF Detection	A voltage or electric field of about 60V	or more is detected.	The bar graph
	and intermittent buzzer beeps change	in five steps	
Bandwidth	45~400Hz		
Bandwidth Battery	45~400Hz LR03 X 2		

Max 100A Hz - - -)) AP DCA DATA RNG HOLD HOLD

660 / 6.6k / 66k / 660k / 6.6M / 66M Ω ± (0.9%+3)

6.6n / 66n / 660n / 6.6 μ / 66 μ / 660 μ / 6.6m / 66mF ± (5.0%+10)

Buzzer sounds at below $30\,\Omega$. Open voltage : approx. 1.2V

+ (1.4%+6)

± (2.0%+5)

 $\pm (0.5\%+3)$

0.1A

0.1 Ω

Test lead : TL-26,TL-37 Adapter: CL-26.TL-A18a

Hybrid Digital Multimeter



PM33a

Hybrid pocket size DMM + Clamp meter

Lightweight approx. 160g

Maximum / Minimum value hold Current measurement with thin U-shaped current sensor(7mm) at angles of 0 and 180 degrees ■AC and DC currents measurable up to 100A

■Data hold Measurement of relative value

Auto power off

Safety: IEC61010-1 CAT.II 600V, CAT.III 300V











DCA Capacitance Frequency

Diode test



H130×W75×D19.9mm / approx160g (including Battery) Clamp diameter φ 10mm Instruction manua

660m / 6.6 / 66 / 600V


660m / 6.6 / 66 / 600V

660 / 6.6k / 66kHz


Carrying case: C-DG3a

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC

CE







Cables in a narrow space can be clamped for current measurement





Analog Multitesters (circuit testers)

What is Analog Multitester?

Analog multitesters basically make measurements of DC voltage, AC voltage, DC current and resistance. Except some special products, they have no function to measure the AC current. Characteristics of recent analog multitesters include the extended measuring range function (particularly for fine voltage and current) with an amplifier installed, the function to allow the measurement of capacitor capacity, and the zero-center meter function. To enhance operability and usability, some products include the auto range function, automatic polarity switching function, and a structure integrating a case to allow the storage of a test lead. There are some testers that allow the measurement of hFE (DC current amplification factor) of a transistor and temperature measurement using a temperature sensor, which is offered as an optional accessory.

Advantages of analog multimeters

Easy to read the mean value of values changing in short cycles.

* A digital tester does not give stable value determination.

No need for the operating power supply except for resistance range (excluding Model EM7000 integrating an amplifier, and CX506a integrating an oscillator) and zero-center function.

Suited for judgment based by intuition (in continuity test etc.).

Four key points in choosing a suitable model

1. What are the necessary measuring func-

Choose the necessary measuring functions in addition to voltage and resistance.

- → Need for the measurement of current (0.25A, 0.3A, 30A),
- → Measurements for remaining dry battery capacity, capacitor,
- → Measurement of DC high voltage with the use of an optional

2. Other necessary functions

- 1) The needle occasionally swings to the opposite direction in DC voltage measurement.
- → Check the polarity by the zero-center meter function.
- 2) Hard to check for continuity
- → Use an LED light-up type in noisy places
- → Use a buzzer type to verify with sounds.



3. Graduation of scale

There are two general types of graduation of the measuring

① 2.5, 5, 10, 50, 250, 500V

② 3, 12, 30, 120, 600V

For measurement of a car battery (24V), measurement in the 30V range of ② is suitable. Choose a type suitable for your intended application.

4. Other functions

Other types are furnished with an auto range function allowing the automatic optimal setting of voltage and resistance. There are also types integrating a transistor transmitter and others integrating a current-limiting fuse with breaking capacity of 100kA for enhanced safe operation.

Basic measuring method

Check the range before making a measurement

Most problems with a tester are caused by overcurrent and drop of the tester. Failures due to overcurrent are most frequently caused by voltage applied to a current range and resistance range with lower internal resistance (thereby causing overcurrent of tens to hundreds times to run through the circuit). Although some testers include a meter protector and a circuit protector using a diode, it is recommended to check the range before measuring.


For measuring unknown values

In measuring unknown current and voltage values, find an approximate value at the maximum range first and then make adjustments to the optimum range (1000V to 250V range in case of voltage measurement).

This method prevents a failure caused by incorrect range adjustment.

* Do not change the range during measurement.

Examples

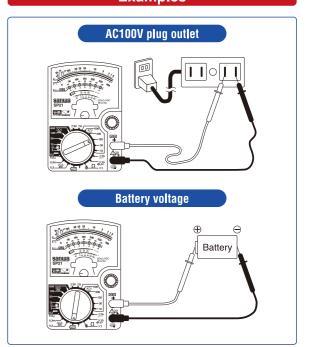

16 www.sanwa-meter.co.jp www.sanwa-meter.co.jp

Analog Multitester Comparative Chart

FE	T Tester	Multifu	nction		Drop	Shock Proof N	Meter		Slim&Compact
Model E	M7000	CX506a	YX-361TR	YX360TRF	SP20	SP21	SP-18D	TA55	AP33

















	A STATE OF THE STA		0				3 2 T		
age	P19	P19	P19	P20	P20	P20	P21	P21	P21
CV(V)	0.3	120m	0.1	0.1	0.25	0.3	0.3	0.3	10
	1.2	3	0.5	0.25	2.5	3	3	3	50
	3	12	2.5	2.5	5	12	12	16	250
	12	30	10	10	10	30	30	30	500
	30	120	50	50	50	120	120	60	-
	120	300	250	250	100	600	600	-	-
	300	1000	1000	1000	500	-	-	-	-
	1000	-	-	-	-	-	-	-	-
CV(V)	3	3	2.5	10	10	12	12	30	50
	12	12	10	50	50	30	30	120	250
	30	30	50	250	250	120	120	300	500
	120	120	250	750	500	300	300	-	-
	300	300	1000	-	-	600	600	-	-
	750	750	-	-	-	-	-	-	-
CA(A)	0.12μ	$30~\mu$	$50~\mu$	50 μ	50 μ	$60~\mu$	$60~\mu$	0.5	25m
	0.3m	0.3m	2.5m	2.5m	2.5m	30m	30m	3	250m

ACV(V)	3	3	2.5	10	10	12	12	30	50
	12	12	10	50	50	30	30	120	250
	30	30	50	250	250	120	120	300	500
	120	120	250	750	500	300	300	-	-
	300	300	1000	-	-	600	600	-	-
	750	750	-	-	-	-	-	-	-
DCA(A)	0.12 μ	30 μ	50 μ	50 μ	50 μ	60 μ	60 μ	0.5	25m
	0.3m	0.3m	2.5m	2.5m	2.5m	30m	30m	3	250m
	3m	3m	25m	25m	25m	0.3	0.3	30	-
	30m	30m	0.25	0.25	0.25	-	-	-	-
	300m	0.3	-	-	-	-	-	-	-
	6	-	-	-	-	-	-	-	-
ACA(A)	6	-	-	-	-	-	-	-	-
Resistance (Ω)	2k	5k	2k	2k	2k	2k	2k	2k	10k
	20k	50k	20k	20k	20k	20k	20k	20k	1M
	200k	500k	200k	200k	200k	2M	2M	200k	-
	2M	5M	2M	2M	2M	-	200M	2M	-
	20M	50M	20M	200M	-	-	-	-	-
	200M	-	-	-	-	-	-	-	-
Capacitance(F)	-	0.2 μ	-	10 μ	500 μ	500 μ	1000 μ	-	-
	-	20 μ	-	-	-	-	-	-	-
	-	2000 μ	-	-	-	-	-	-	-
Low frequency output measurement	•	-	•	•	-	-	-	-	-
Continuity	-	-	LED	-	Buzzer	-	-	Buzzer	-
Battery check	-	-	1.5V	-	1.5V	1.5V	1.5V	12V	1.5V/9V
Meter structure	Band	Band	Band	Band	Band	Band	Band	Band	Pivot
Drop shock proof meter	-	-	-	•	•	•	•	•	-
Zero center meter	•	-	•	•	-	•	-	-	-
Temperature measurement	-	-	-	-	0	-	-	-	-
hFE	-	•	0	0	-	-	-	-	-
Dimension H (mm)	165	165	150	159.5	144	144	159.5	142	126
Dimension W(mm)	106	106	100	129	99	99	129	97	87
Dimension D (mm)	46	46	37	41.5	41	41	41.5	38	30
Mass (g)	375	370	290	320	270	270	320	300	185

FET Tester



EM7000

High sensitivity for measurement of lower capacitance

 \blacksquare High input impedance (DCV2.5 \sim 12M Ω /V), and $0.12 \mu A range (DCA)$ ■ Bandwidth 40Hz~1MHz AC sign wave

Rectangular pulse P-P (Peak to Peak) measurement (duty cycle 20% and above) ■ Wide ohm range $0.2\,\Omega$ ~200M Ω

Bandwidth: 40Hz~1Mhz (12V range and below)

HV probe : HV-60 Carrying case : C-CA

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4, TL-A7M,TL-A7M2

Test lead : TL-21M, TLF-120



EM7000	Measuring range	Accuracy
DCV	0.3/1.2/3/12/30/120/300/1000V	$\pm 3\%$ of full scale
±DCV	$\pm 0.15/0.6/1.5/6/15/60/150/600V$	$\pm 7\%$ of full scale
ACV rms (50 / 60Hz)	3V (approx. $2.5M\Omega$)/12V (approx. $1.1M\Omega$) 30V (approx. $800k\Omega$)/120/300V (approx. $800k\Omega$)/750V (approx. $10M\Omega$)	±3% of full scale
ACV P-P	Sine wave:8.4V (approx. 2.5M Ω /V)/ 33V (approx. 1.1M Ω /V) 84V (approx. 800M Ω /V)/330/840V (approx. 800k Ω /V)	\pm 5% of full scale
	Square symmetric wave:8.4V (2.5M Ω/V)	\pm 6% of full scale
	Triangular symmetric wave:8.4V (2.5M Ω/V)	\pm 6% of full scale
DCA	0.12 μ /0.3m/3m/30m/300m/6A	$\pm 3\%$ of full scale
DCA (NULL)	$\pm 0.06 \mu/\pm 0.15$ m/1.5m/15m/150mA	$\pm7\%$ of full scale
ACA	6A	$\pm 3\%$ of full scale
Resistance	$2k/20k/200k/2M/20M/200M\Omega$	$\pm 3\%$ of scale length
dB	-10∼+51dB	$\pm 3\%$ of scale length
Bandwidth	40Hz∼1MHz (below 12V range)	
Battery	R6P 1.5V×2, 6F22 9V×1	
Fuse	φ 5.0×20mm ceramic (250V / 0.5A)	
	φ 5.0×20mm ceramic (250V / 6.3A)	
Size / Mass	H165×W106×D46mm / approx. 375g	
Standard acce- ssories included	Test lead (TL-21a), Spare fuse, Instruction mar	nual

The value in () at DCV and ACV is input resistance.

Multifunctional model



CX506a

Capacitor & Transistor checker (built-inoscillator)

■ 26ch switch, wide range measurement ■ Capacitance measurement 50pF~2000 μF High input impedance 50kΩ / V (DC3~300Vrange) Switchable DC polarity

Bandwidth: 40Hz~30kHz (3V and 12V), 40Hz~10kHz (30V range)

HV probe : HV-60

Carrying case : C-CA Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4, TL-A7M,TL-A7M2

Test lead : TL-21M, TLF-120





X506a	Measuring range	Accuracy
CV	120m (4kΩ)/3/12/30/120 300 (50kΩ/V)/1000V (15kΩ)	120m : ±4% ±2.5% of full scale
CV	3/12/30/120/300/750V (8kΩ/V)	±3% of full scale (3/12V: ±4%)
CA	30 μ/0.3m/3m/30m/0.3A	\pm 2.5% of full scale (30 μ /0.3m: \pm 3%)
esistance	$5k/50k/500k/5M/50M\Omega$	$\pm 3\%$ of scale length
apacitance	C1 : $50p\sim0.2\mu\text{F}$	\pm 6% of scale length
FE (DC Current mplification Factor)	Transistor hFE:0∼1000	-
andwidth	40~30kHz (12V:40Hz~30kHz 30V~	: 40Hz~10kHz)
attery	R6P×2, 6F22×1	
use	ϕ 5.0×20mm (250V/0.5A) arc-extingishing material in ϕ	ceramic tube
		ceramic tube
ize / Mass tandard ccessories included	(250V/0.5A) arc-extingishing material in o	



YX-361TR

■ Total 33 wide ranges (24ch sw + additional functions)

■ ±DCV zero center meter ■ LED for continuity check

OUTPUT terminal (series capacitor terminal) Battery check

HV probe : HV-10

Carrying case : C-YS Adapter : CL-15a, CL-14, CL-DG3a, TL-9IC

hFE probe : HFE-6T







YX-361TR	Measuring range	Accuracy
DCV (NULL)	$\begin{array}{l} 0.1/0.5/2.5/10/50/250/1000V \;\; (20k\Omega/V) \\ \pm 5/25V \;\; (40k\Omega/V) \end{array}$	±2.5% of full scale ±5% of full scale
ACV	2.5/10/50/250/1000V (9kΩ/V)	±3% of full scale (2.5/10V : ±4%)
DCA	50 μ/2.5m/25m/0.25A	$\pm 2.5\%$ of full scale
Resistance	$2k/20k/200k/2M/20M\Omega$	±3% of scale length
dB	-10∼+62dB	±3% of full scale (2.5/10V : ±4%)
Continuity	LED : emitting light at 10 Ω or less. Open voltage : 3V	
Battery check	1.5V	
hFE	1000 at \times 10 range (optional probe "HFE-6T" is necessary)	_
Bandwidth	40~20kHz (less than 50V : ±3%)	
Battery	R6P×2, 6F22×1	
Fuse	φ 5.2×20mm (250V / 0.5A)	
Size / Mass	H150×W100×D37mm / approx. 290g	
Standard accessories included	Test lead (TL-61), Instruction manual	

The value in () at DCV and ACV is input resistance.

Optional accessory is necessary.

Analog Multitester

Drop shock proof meter



YX360TRF

Best seller drop shock proof meter

hFE probe : HFE-6T


Adapter : CL-14, CL-15a, CL-DG3a, TL-9IC High voltage probe : HV-10T





Drop shock proof meter

- Null (zero center) meter ±5 / ±25 in DCV
- High resistance up to 200M Ω with low voltage Protective body cover
- Capacitance, dB, Li measurement



- Bandwidth: 30~100kHz (AC10V)



SP21

Continuity check buzzer

- Drop shock proof taut-band meter
- ±DCV zero center meter Fuse and diode protection
- Battery check
- Tilt stand

Bandwidth: 40~100kHz (AC12V)

HV probe : HV-20

Carrying case : C-SPH or C-SP Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC

TL-A4. TL-A7M.TL-A7M2

Test lead : TL-21M. TLF-120







DSP hFE H

(NULL)

Capacitance

DC high voltage

dB

hFE

Battery

Size / Mass

0.1V (20kΩ / V)

 $\pm 5\,/\,25V\;(40k\,\Omega\;/\;V)$

200MΩ (X100k)

Load current (LI) $0\sim150\text{m}/15\text{m}/1.5\text{m}/150~\mu/1.5~\mu\text{A}$

10 / 50 / 250 / 750V (9kΩ / V)

50 μ / 2.5m /25m / 0.25A

R6 (IEC) or UM-3(1.5V)×2

φ 5.2×20mm (250V / 0.5A)

*1 Pointer indication of the maximum move by charged current in the capacitor.

 $0.25/2.5/10/50\,(20k\Omega\,/\,V)/250/1000V(9k\Omega\,/\,V)$ $\pm 3\%$ of full scale

 $2k \, / \, 20k \, / \, 200k \, / \, 2M \, \Omega \, \left(\, X1 \, / \, X10 \, / \, X100 \, / \, X1k \right) \quad \pm 3\%$ of scale length

The value in bracket at DCV and ACV is input resistance.

-10dB~+22dB (for 10VAC) ~+62dB -

1000 at X10 range (optional probe "HFE-6T" is necessary) —

DC25kV (optional probe "HV-10T" is necessary) -

H159.5×W129×D41.5mm / approx. 320g Instruction manual, Hand strap

±5% of full scale

±5% of full scale

±4% of full scale

 $\pm 3\%$ of full scale

±5% of scale length



SP21	Measuring range	Accuracy
DCV (NULL)	0.3 $(5k\Omega)/3/12/30/120/600V$ $(20k\Omega/V)$ $\pm 6/30V$ $(20k\Omega/V)$	±3% of full sca ±5% of full sca
ACV	12/30/120/300/600V	±3% of full sca
DCA	60 μ/30m/0.3A	±3% of full sca
Resistance	2k/20k/2M Ω	±3% of scale len
Capacitance	500 μ F	*1
Continuity	Buzzer sounds at less than approx. 10 $\Omega.$ Op	oen voltage: 3V

R6PX2 Battery φ5×20mm (250V/0.5A) Size / Mass H144×W99×D41mm/approx. 270g Test lead (TL-21a), Instruction manual

40~100kHz (AC12V)

The value in () at DCV and ACV is input resistance *1 Pointer indication of the maximum move by charged current in the capacitor



Drop shock proof meter

TA55

SP-18D

range Battery check

Protective body cover

Protective body cover

(AC30V)

Adapter : CL-14, CL-15a, CL-DG3a, TL-9IC

Low power ohm (3V) measurement up to 200M Ω

■ Capacitance measurement 0.01 μ F \sim 1000 μ F

■ LED check by 3V terminal voltage at resistance

Bandwidth: 30~80kHz (AC12V), 30~20kHz

30A range for automotive

- High level panel visibility
- Continuity check buzzer
- Tilt-stand
- Measurable up to DC30A / DC300A with optional clamp probe

Bandwidth: 40~5kHz

Clamp probe : CL33DC Carrying case : C-SPH or C-SP Adapter: CL-14, CL-15a, CL-DG3a, TL-9IC Test lead : TL-91M, TLF-120



DCV

DCA

Battery

Size / Mass

DCV

DCA

Resistance

Bandwidth

Fuse





φ 6.4×30mm (250V/3A)

H142×W97×D38mm/approx. 300g

0.3/3/12/30/120/600V (20k Ω/V)

30~70kHz (AC 12V) 30~20kHz (AC 30V)

The value in () at DCV and ACV is input resistance.

12/30/120/300/600V (9kΩ/V)

φ 5.2×20mm (250V/0.5A)

*1 Pointer indication of the maximum move by charged current in the capacitor.

H159.5×W129×D41.5mm / approx. 320g

60 u/30m/0.3A

1000 μ F

B6PX2

accessories included Instruction manual

2k/20k/2M/200M Ω

1.5V/1.5V Coin battery

±3% of full scale

±3% of full scale

±3% of scale length

(200M Ω:±5%)

Test lead (TL-91), Instruction manual The value in () at DCV and ACV is input resistance.

$\label{eq:decomposition} \mbox{DC high voltage \& temperature measurable}$

- Capacitance measurement 500 μF
- Tilt stand
- (with optional accessories)

Bandwidth: 40~100kHz (AC10V)

HV probe : HV-10

Carrying case : C-SPH or C-SP Adapter: CL-14, CL-15a, CL-DG3a, TL-9IC









SP20	Measuring range	Accuracy
DCV	0.25/2.5/5/10/50/100V (20kΩ/V)/500V (9kΩ/V)	±3% of full sca
ACV	10/50/250/500V (9kΩ/V)	±3% of full sca
DCA	50 μ/2.5m/25m/0.25A	±3% of full sca
Resistance	2k/20k/200k/2MΩ	±3% of scale ler
Capacitance	500 μ F	*1
DC high voltage	DC25kV (Optional probe "HV-10" is necessary)	_
Temperature	-20 \sim +200 $^{\circ}\text{C}$ (Optional probe *T-THP* is necessary)	±3% (T-TH
Bandwidth	40~100kHz (AC10V)	
Battery	R6P×2	
Fuse	φ 6.3×30mm (250V/0.5A)	
Size / Mass	H144×W99×D41mm/approx. 270g	
Standard accessories included	Test lead (TL-61), Instruction manual	



AP33

Small pocket size

- Elastomer material absorbs shock from fall
- High-durability nylon-woven copper lead
- Using elastomer material improves flexibility and reduces the stress on the lead wire and the

probe when bent. Bandwidth: 40~10kHz (50V and below)



AP33	Measuring range	Accuracy
DCV	10/50/250/500V (2kΩ/V)	$\pm 5\%$ of full scale
ACV	50/250/500V (2k Ω/V)	$\pm 5\%$ of full scale
Battery check	1.5V/9V	_
DCA	25m/250mA	±5% of full scale
Resistance	$5k/500k\Omega$	±3% scale length
Bandwidth	40~10kHz (less than 50V)	
Battery	R03×1	
Fuse	φ5×20mm (250V/0.5A)	
Size / Mass	H126×W87×D30mm/approx. 185g	
Standard	Instruction manual	

The value in () at DCV and ACV is input resistance.



SP20

- 20ch measurement ranges
- DC high voltage and temperature measurement

Temperature probe : T-THP





	Measuring range	Accuracy
	0.25/2.5/5/10/50/100V (20kΩ/V)/500V (9kΩ/V)	±3% of full
	10/50/250/500V (9k Ω/V)	±3% of full
	50 μ/2.5m/25m/0.25A	$\pm 3\%$ of full
	$2k/20k/200k/2M\Omega$	±3% of scale
	500 μ F	*1
е	DC25kV (Optional probe "HV-10" is necessary)	-
	-20 \sim +200 $^{\circ}\!\text{C}$ (Optional probe "T-THP" is necessary)	±3% (T-T
	40~100kHz (AC10V)	
	R6P×2	

The value in () at DCV and ACV is input resistance.

www.sanwa-meter.co.jp

Insulation Resistance Testers

What is Insulation Resistance Tester?

The measurement of insulation resistance is performed **Examples of major applications of insulation resistance tester** to check the insulation status of electric equipments and circuits, which constitutes one of the important measuring items for safety control. The measurement of the insulation of electric equipments and circuits is made using an insulation resistance tester by stopping the operation of the electric equipments and circuits (by stopping power distribution). Voltage of several megohms to tens of megohms is measured in case of the measurement of insulation resistance of electronic parts and electric equipments, and voltage of $1M\Omega$ or less is measured in case of electric works for interior wiring and others.

Is not the resistance range of a multimeter adequate for the measurement of insulation resistance?

The resistance of a digital multimeter or multitester covers the applied voltage (measured voltage) of approx. 0.3V up to 12V. An insulation resistance tester needs to make measurements at voltage higher than the working voltage of a circuit and electric and electronic equipment to be measured. The table on the right lists examples of rated voltage and uses of the insulation resistance tester.

Rated measurement voltage	General electric equipments	Electric equipments and circuits
	Insulation measurement at safe voltage	
25V 50V	Insulation measurement of telephone circuit equipments and explosion-proof equipments	Insulation measurement of telephone circuits
100V 125V	Insulation measurement of control equipments	Insulation measurement for maintaining and controlling low-voltage distribution wiring and equipments of 100V or less Insulation measurement for maintaining and controlling low-voltage wiring and equipments of 200V class or lower
250V	Insulation measurement of low-voltage distribution circuits and equipments	Insulation measurement for maintaining and controlling low-voltage wiring and equipments of 400V class or lower Insulation measurement of 100V, 200V and 440V classes at the time of new installation
500V	Insulation measurement of newly installed distribution circuits, and circuits and equipments of 600V or less (General)	Insulation measurement for maintaining and controlling low-voltage wiring and equipments of lower than 600V Insulation measurement of 100V, 200V and 400V distribution wiring at the time of new installation
1000V	Insulation measurement of circuits, equipments, and facilities of higher than 600V (General)	Insulation measurement of equipments normally operating at high working voltage (e.g. high-voltage cable, high-voltage electric equipment, and communications equipment using high voltage)

Three key points in choosing a suitable model

1. Analog type or digital type?

Analog type is suitable for visually checking the measurement. Digital type is suitable for verifying the measurement by precise values.

2. What do you like to measure by your insulation resistance tester?

For measurement of electronic circuits and the like (See Figure 1) below) → For easy reading of higher resistance : DM series / Digital type For use in measurement in electric works and the like (See Figure $\ensuremath{\mathfrak{D}}$ below) → For easy reading of lower resistance : PDM series / Digital type

3. Required rated voltage

A wide voltage range is available from 15V (optimum for maintaining and controlling elevators) up to 1000V / $4000M\Omega$

There are types allowing two to seven ranges by one unit.

Measuring method of low-voltage circuit

using high voltage)

In order to measure the insulation resistance of a low-voltage circuit, use an insulation resistance tester with the rated voltage of 500V. Open switches in the distribution board, shut off the power distribution and measure the insulation resistance between wires on the circuit and between wire and ground. If the measured value is below the reference value, open all branch switches and make measurements separately for each branch line of the mains line. The insulation resistance value of the low-voltage circuit is stipulated according to the Electrical Equipment Standard.

Use volta	age class of circuit	Insulation resistance value	
300V or less	When voltage to ground is 150V or less (Voltage to ground: Voltage between wire and the earth in case of a ground type circuit, and voltage between wires in case of a non-ground type circuit. The same applies hereinafter.)	0.1ΜΩ	(
	Other cases	0.2ΜΩ	
More th	an 300V	0.4ΜΩ	

Scale-division method of the 1st and 2nd effective measurement range





Insulation	Resistance	Tester Cor	mparative Chart	

PDM1529S

PDM5219S

Model		Digital Type						
		MG5000	HG561H	MG1000	MG500	M53		
					D William			
Page		P24	P25	P25	P25	P26		
Category		CAT.IV 600V	CATIII 300V CATII 600V	CATIII 600V	CATIII 600V	-		
CE		•	•	•	•	-		
	5000V 2500V 1000V	1000G Ω 100G Ω 2000M Ω	- - -	- - 4000MΩ	-	-		
Test voltage	500V 250V	1000MΩ 100MΩ	110MΩ 110MΩ	4000M Ω 4000M Ω 4000M Ω	4000M Ω 4000M Ω	200MΩ		
	125V 100V	-	110MΩ 110MΩ	-	4000MΩ -	-		
	50V/25V 15V	-	21MΩ 21MΩ	-	-	- 20M Ω		
ACV(V)/DCV(V)	1000/1000	600/600	600/600	600/600	750/750		
Resistance (2)	-	999.9/99.99k 999.9k	40/4000	40/4000	-		
Discharge		•	•	•	•	-		
Inner battery	check	•	•	•	•	-		
Backlight		•	•	•	•	-		
Live circuit de	tection	•	•	•	•	-		
Dimension H	(mm)	188	139	170	170	175		
Dimension W	(mm)	225	91	142	142	115		
Dimension D	(mm)	97	29	57	57	55		
Mass (g)		1750	230	600	600	600		
				Analog Type				

		0				
Page		P26	P26	P27	P27	P27
Category		-	-	-	-	-
CE		•	•	•	•	•
	1000V	2000ΜΩ	-	2000ΜΩ	-	-
Test voltage	500V	100ΜΩ	100ΜΩ	-	1000ΜΩ	100MΩ
	250V	100ΜΩ	100ΜΩ	-	-	-
	125V	-	100ΜΩ	-	-	-
ACV(V)/DCV(V	/)	600/60	600/60	600/60	600/60	600/60
Resistance (Ω)	-	-	-	-	-
Discharge		•	•	•	•	•
Inner battery cl	heck	•	•	•	•	•
Backlight		-	-	-	-	-
Live circuit dete	ection	-	-	-	-	-
Dimension H (r	mm)	144	144	144	144	144
Dimension W (mm)	99	99	99	99	99
Dimension D (r	mm)	43	43	43	43	43
Mass (n)		210	210	210	210	210

DM1009S

DM509S

PDM509S

Insulation Resistance Tester

High voltage Type



MG5000

This instrument is a high voltage insulation resistance tester for use in measurement of Insulation Resistance of a power line and power equipment within the range

■Test voltage DC5000V/2500V/1000V/500V/250V ■Insulation Resistance up to 1TΩ

Display : numeral display 1200 Sampling rate: 3 times / sec. Safety: IEC61010 CAT.IV 600V

of 600V under CAT.IV.

■Short circuit current up to 4mA Dielectric Absorption Ratio (DAR) Polarisation Index (PI) Auto discharge function ■Data hold(Auto) Auto power save: Power save about 10 minutes after the last operation



 ϵ











	Measuring range							
Test Voltage(DC)	250V	500V	1000V	2500V		5000V		
Range	0.0~104.9MΩ	0.0∼99.9MΩ 80∼1049MΩ	0.0~99.9MΩ 80~999MΩ 0.80~2.09GΩ	0.0~99.9MΩ 80~999MΩ 0.80~9.99GΩ 8.0~104.9GΩ	$0.0\sim99.9M\Omega$ $80\sim999M\Omega$ $0.80\sim9.99G\Omega$ $8.0\sim99.9G\Omega$	80~1000GΩ	1001~119	
Accuracy	±5%+3	±5%+3	±5%+3	±5%+3	±5%+3	±20%	-	
Open circuit voltage	DC250V 0%~+20%	DC500V 0%~+20%	DC1000V 0%~+20%	DC2500V 0%~+20%		DC5000V 0%~+20%		
Rated test current				$3mA\pm0.5mA$				
Short circuit current				$3mA\sim4mA$				

Open circuit voltage	DC250V 0%~+20%	DC500V 0%~+20%	DC1000V 0%~+20%	DC2500V 0%~+20%	DC5000V 0%~+20%	
Rated test current	0 /01 9 + 20 /0	0 /0' 9+20 /0	0 /6 9 +20 /6	3mA±0.5mA	0 /6' 9 +20 /6	
Short circuit current				3mA~4mA		
Voltage measurement	AC:30~1000\	(50/60Hz)、DC	: 30~1000V 、	Accuracy: ±(2%	+3dgt)	
LCD	Bar graph : 36 points DAR/PI value : 9.99 Timer : 99:59(min : sec)					
Overload indication	Overload indication V function: "OL" displayed with buzzer beep Insulation function: "OL" displayed					
Max. power consu	mption	Approx. 1	8 VA (measur	rement at 5000	V/approx. 1.8 MΩ)	
Battery Monitor	4-step ind	4-step indication				
IP rate	tte IP54					
Battery LR14 x 8						
Size / Mass	ze / Mass H188 x W225 x D97mm / 1750g(Batteries included)					

Test lead(TL-5K)
LINE lead(TL-5K-R:Red,3m), EARTH lead (TL-5K-B:Black,3m),
GUARD lead (TL-5K-G:Green,3m), Alligator clip (TL-5K-A), Standard accessories included Test probe (TL-5K-P), Hook probe (TL-5K-H) Carrying case(C-MG5K), Instruction manual, Battery(LR14 x 8)

Optional accessories

LINE lead : TL-5K-15 (Red,15m)





TL-5K







Digital Type



 ϵ

 ϵ

MG1000 MG500

Allows you to measure insulation resistance more safely by avoiding operation mistakes.

■Hot-line state (30V minimum) detection Large volt mark with the buzzer sound Automatic data hold function ■Bar graph just like analog meter ■Large display with backlight ■Easy to use & tough body

Display: numeral display 4000 Sampling rate: 2 times / sec. Safety: IEC61010 CAT. III 600V

Test lead: TLF-120 (MG500 Only), TL-BP



1000/500/250V

1.0~1.2mA

2mA or less

Test voltage

ACV/DCV

Continuity

Continuity (200mA)

Open circuit voltage

Short-circuit current

Rated current

Size / Mass

4000W 32 4	4000W 32
MG500	Measuring range Best accuracy Resolution
MΩ	$400k/4M/40M/400M/4000MΩ$ \pm (3%+4) 0.001MΩ
Test voltage	500/250/125V
ACV/DCV	600V (AC/DC Automatic detection) ± (3%+2) 1V
Continuity	4000 Ω (Buzzer and ALARM indicator) \pm (3%+3) 1 Ω
Continuity (200mA)	± (3%+10) 0.01 Ω
Open circuit voltage	1 to 1.3 times of nominal test voltage
Rated current	1.0~1.2mA
Short-circuit current	2mA or less
Live circuit detection	At ≧30V AC/DC or more, inhibits test, buzzer sounds and ALARM indicator lights up.
Battery	R6×6
Size / Mass	H170×W142×D57mm/approx. 600g
Standard accessories	Test Lead (TL-112a), Strap (ST-50), Instruction Manual

 $4M/40M/400M/4000M\Omega$ \pm (3%+4) 0.001M Ω

600V (AC/DC Automatic detection) ± (3%+2) 1V

 \pm (3%+10) 0.01 Ω

4000 Ω (Buzzer and ALARM indicator) \pm (3%+3) 1 Ω

At \geq 30V AC/DC or more, inhibits test, buzzer sounds and

Test Lead (TL-112a), Strap (ST-50), Instruction Manual

1 to 1.3 times of nominal test voltage

H170×W142×D57mm/approx. 600g

ALARM indicator lights up.

 ϵ

HG561H


Front cover image >

Pocket size, 7 test voltage ranges

■Test voltage selection mode $\blacksquare LED$ level meter shows $M\,\Omega$ ■Easy-to-read LCD with fixed decimal point Automatic data hold function ■LCD with backlight & LED light for dark place

Sampling rate: approx. 2 times / sec. Safety: IEC61010 CAT.III 300V CAT.II 600V

Test lead : TL-28, TL-BP (Test lead TL-28 is necessary)

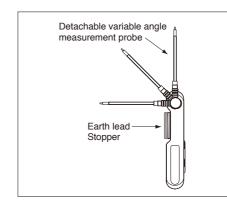



HG561H	Measuring range	Best accuracy	Resolution				
МΩ	15/25/50V 9.99M/21.0M Ω 100/125/250/500V 9.99M/99.9M/110M Ω	±(2%+5)	0.1ΜΩ				
Test voltage	15/25/50/100/125/250/500V	15/25/50/100/125/250/500V					
ACV/DCV	600V (AC/DC Automatic Detection)	±(1.6%+7)	0.1V				
Ω	$999.9/99.99k/999.9k\Omega$	±(1.5%+7)	0.1 Ω				
Insulation Resistance (Level meter)	15/25/50V 5 Levels(LED light up/blinking) 100/125/250/500V 7 Levels(LED light up/blinking)						
Continuity	Buzzer sounds at 30.0 or less	, 5 . 5/					
Rated current	1.0~1.2mA						
Battery	LR03×4						
Size / Mass	H139×W91×D29mm/approx. 230g						
Standard accessories Mesurement probe (TL-561), Alligator clip (CL- carrying case (C-DG3a), Instruction manual							



24 www.sanwa-meter.co.jp 25

www.sanwa-meter.co.jp

Digital Type



2 test voltage ranges for elevator maintenance

- Test voltage DC500V / 15V Auto range
- Auto power off (1min.)

 Low battery power indication
- Remote speed measurement (Speed meter SE9100 is necessary.)
- Display: numeral display 1999

Carrying case : C-M53

M53

AP	500V	15V
OFF	200MΩ	20MΩ
M53		

M53	
МΩ	$2M/20M/200M\Omega$ (3 auto ranges)
Accuracy	Within ± (2%+2)
ACV	200/750V (2 auto ranges)
Accuracy	Within ± (1%+0.5%RNG+1)
DCV	20/750V (2 auto ranges)
Accuracy	Within ± (0.5%+0.5%RNG+1)
Rated current	500V/1.0~1.2mA
Battery	LR6×6
Size / Mass	H175×W115×D55mm/approx. 600g
Standard accessories included	Test lead (red/black with plug) and clip lead connecting to pin (TL-M54) , Instruction manual

Analog Type



PDM1529S

3 test voltage ranges

- Test voltage DC1000V / 500V/ 250V
- Easy viewing and readable scale graduations One-shot or continuous measurement push switch
- DCV measurement range (DC60V)
- Auto discharge function
- Inner battery check range
- Safety: IEC61010-1 CAT.III 600V

Test lead : TLF-120, TL-BP

	Insulation resistance (MΩ)	0.5~ 2~1000 ~2000MΩ 1000V 0.02~ 0.1~50 ~100MΩ 500/250V
	Accuracy	±5% of reading (1st effective measurement range : written in thick print above) ±10% of reading (2nd effective measurement range : written in small type above)
	ACV	600V ±5% of full scale (50~60Hz sine wave)
	DCV : Accuracy	60V ±5% of full scale
	Rated current	1.0~1.2mA
_	Battery	6LR61 (9V)×1
	Size / Mass	H144×W99×D43mm/approx. 310g
	Standard accessories included	Test lead (TL-509S), Carrying case (C-09S), Instruction manual

ϵ

PDM5219S

3 test voltage ranges

- Test voltage DC500V/ 250V / 125V
- Easy viewing and readable scale graduations One-shot or continuous measurement push switch
- DCV measurement range (DC60V)
- Auto discharge function
- Inner battery check range
- Shoulder Strap

Safety: IEC61010-1 CAT.III 600V

pilioliai accessories	
lead : TLF-120, TL-BP	
oter : TL-A51	

Insulation resistance (M Ω)	0.02~ 0.1~50 ~100MΩ 500/250/125V
Accuracy	±5% of reading (1st effective measurement range : written in thick print above) ±10% of reading (2nd effective measurement range : written in small type above)
ACV Accuracy	600V ±5% of full scale (50~60Hz sine wave)
DCV Accuracy	60V ±5% of full scale
Rated current	1.0~1.2mA
Battery	6LR61 (9V)×1
Size / Mass	H144×W99×D43mm/approx. 310g
Standard	Test lead (TL-509S), Carrying case (C-09S),

ϵ





Analog Type

DM1009S

Single test voltage range

- Test voltage DC1000V 2000M Ω
- One-shot or continuous measurement push switch DCV measurement range (DC60V)
- Auto discharge function
- Inner battery check range
- ACV measurement range
- Shoulder Strap
- Safety: IEC61010 CAT. III 600V

Test lead : TLF-120, TL-BP

AD 1000V 2000ΜΩ

DM1009S	
Insulation resistance (MΩ)	$1{\sim}\textbf{2}{\sim}\textbf{1000}{\sim}2000\text{M}\Omega$
Accuracy	±5% of reading (1st effective measurement range: written in thick print above ±10% of reading (2nd effective measurement range: written in small type above
ACV : Accuracy	600V ±5% of full scale (50~60Hz sine wave)
DCV	60V ±5% of full scale
Rated current	1.0~1.2mA
Battery	6LR61 (9V)×1
Size / Mass	H144×W99×D43mm/approx. 310g
Standard accessories included	Test lead (TL-509S), Carrying case (C-09S), Instruction manual



Single test voltage range

- Test voltage DC500V 1000M Ω One-shot or continuous measurement push switch
- DCV measurement range (DC60V)
- Auto discharge function Inner battery check range
- Shoulder Strap

Safety: IEC61010 CAT. III 600V

Test lead : TLF-120, TL-BP

Adapter : TL-A51



DM509S	
Insulation resistance $(M\Omega)$	$0.5{\sim}1{\sim}\textbf{500}{\sim}1000\text{M}\Omega$
Accuracy	±5% of reading (1st effective measurement range : written in thick print above) ±10% of reading (2nd effective measurement range : written in small type above)
ACV : Accuracy	600V ±5% of full scale (50~60Hz sine wave)
DCV : Accuracy	60V ±5% of full scale
Rated current	1.0~1.2mA
Battery	6LR61 (9V)×1
Size / Mass	H144×W99×D43mm/approx. 310g
Standard accessories included	Test lead (TL-509S), Carrying case (C-09S), Instruction manual

PDM509S

Single test voltage range

- Test voltage DC500V 100M Ω
- One-shot or continuous measurement push switch
- DCV measurement range (DC60V)
- Auto discharge function Inner battery check range
- ACV measurement range Shoulder Strap

Safety: IEC61010 CAT. III 600V

Test lead : TLF-120, TL-BP

	3004
1	100ΜΩ

Insulation resistance (MΩ)	$0.05\sim$ 0.1~50~ 100M Ω
Accuracy	±5% of reading (1st effective measurement range : written in thick print above ±10% of reading (2nd effective measurement range : written in small type above
ACV Accuracy	600V ±5% of full scale (50~60Hz sine wave)
DCV : Accuracy	60V ±5% of full scale
Rated current	1.0~1.2mA
Battery	6LR61 (9V)×1
Size / Mass	H144×W99×D43mm/approx. 310g
Standard accessories included	Test lead (TL-509S), Carrying case (C-09S), Instruction manual


26 www.sanwa-meter.co.jp

Clamp Meters

What is Clamp Meter?

Clamp meters are convenient measuring instruments that allow the measurement of current simply by clamping a wire while being energized without cutting a circuit. In cases of measurement by a multitester and digital multimeter, the circuit must be cut to measure current. In contrast, with a clamp meter, current can be measured simply by clamping a live wire over its sheath. In addition to its simple operation, it allows safe measurement of a higher current since it is not directly connected to the circuit.

Like a multitester and insulation resistance tester, there are analog and digital types of clamp meters. The measuring range is typically about 20A to 200A or 400A both for DC and AC. As a special type, there are products allowing for the measurement of a higher current of 2,000A. Some types are also available to allow measurements of fine current of few milliamps for the purpose of detecting leakage current. Others allow the measurement by true RMS values for measurement of current of distorted AC waveforms other than of sine waves, for inverter power supply and switching power supply.

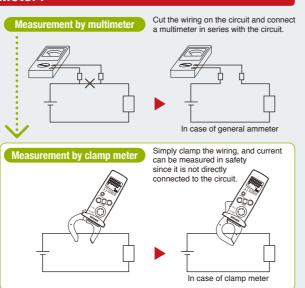

Four key points in choosing a suitable model

1. What are objects to be measured?

Models to be chosen differ depending on what you intend to measure, AC current, DC current or leakage current.

2. Measurable conductor sizes

A wide range of sizes are available from 21mm to 150mm in diameter according to measurable conductor sizes and measuring places.

3. Is true RMS measurement required?


A clamp meter of the mean-value type cannot provide accurate results in the measurement of an inverter circuit and a motor circuit having many distortions. To make measurements for such circuits, a clamp meter of the true RMS type is required.

4. Other functions

Other types are available featuring a tester function and recorder output function in addition to current measurement.

Measuring method by clamp meter

For measuring current using a clamp meter, clamp one conductor (wire) to be measured. If two wires (parallel lines) are clamped, current measurement cannot be made. Take a measurement at the center of the core of the clamped portion to minimize measuring errors. A line separator is conveniently used in measuring the consumption current of home electric appliances. There are line separators that can amplify measured current 10 times to allow measurement by amplifying current lower than 1A. When DC current (DCA) is measured using a clamp meter for DC current, the current is indicated in a negative value (–) when the direction of the current is reversed. By using this function, you can know whether your car battery is at the state of charge or discharge.

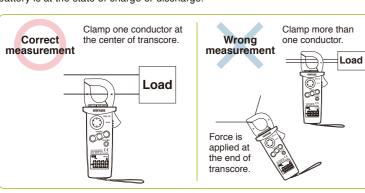


True RMS measurement

A clamp meter of the mean value type detects the mean value of sine waves in AC measurement, multiplies the value 1.11 times (sine wave AC) and indicates it as the effective value. It even indicates the waveform of a distorted wave and the non-sine wave with different form factors in values multiplied 1.11 times, so indication errors occur as a result. For these measurements, use a clamp meter of the true RMS type that detects and indicates the true RMS value itself

Measurement of leakage current

Unlike ordinary current measurement, it is required to clamp all two wires (two-wire single-phase) or three wires (three-wire single-phase or three-wire three-phase) for measuring leakage current. The earthing wire also can be measured.

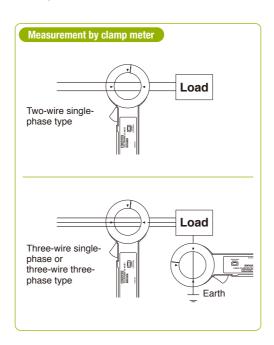

Clamp Meter Comparative Chart

			AC+True RMS			A	С
Model	DCL11R	DCM60R	DCM660R	DCL1200R	DCL3000R	DCM400	DCL1000
Page	P31	P31	P31	P32	P32	P32	P33
Count	6000	1999	6600	6000	3150	4000	4000
Category	CATIII 300V	CATIII 300V	CATIII 600V	CATIII 600V	CATIV 600V	CATIII 300V	CATIII 600V
		CATII 600V				CATII 600V	
CE	•	•	•	•	•	•	•
True RMS (AC)	•	•	•	•	•	-	-
Clamp diameter (mm)	22	25	30	42	150	25	42
Range	А	Α	Α	A/M	Α	Α	A/M
DCA(A) max	-	-	-	-	-	-	-
ACA(A) max	300	600	660	1200	3000	400	1000
Resolution (A)	0.01	0.1	0.01	0.1	0.01	0.01	0.1
DCV(V) max	-	-	600	600	-	600	600
ACV(V) max	-	600	600	600	-	600	600
Resistance (Ω) max	-	199.9	660	600	-	400	40M
Capacitance (F) max	-	-	-	2000 μ	-	-	-
Frequency	-	-	•	•	-	•	-
Continuity	-	Buzzer	Buzzer	Buzzer	-	Buzzer	Buzzer
Diode test	-	-	-	•	-	-	•
AutoV Ω	-	-	-	•	-	-	-
EF detection	-	-	-	•	-	-	-
Low Pass Filter	-	-	-	-	-	-	-
Backlight	•	-	•	•	•	-	-
Auto power off/save	Off	-	Save	Off	Off	Off	Off
Data hold	•	•	•	•	•	•	•
Range hold	-	-	-	•	-	-	•
Peak hold	-	-	-	-	-	-	-
Inrush	-	-	•	-	-	-	-
Relative value	-	-	-	-	-	-	•
Bar graph	-	-	-	-	-	•	-
Dimension H (mm)	145	187	208	238	120	193	238
Dimension W (mm)	54	50	69	95	70	50	95
Dimension D (mm)	31	29	38	45	26	28	45
Mass (g)	120	210	265	290	300	230	290

Clamp Meter

Data hold

Range hold Peak hold Inrush

Relative value

Dimension H (mm)

Dimension W (mm)

Dimension D (mm)

Bar graph

Mass (g)

Pointer Lock

97

43

420

208

69

38

260

Clamp Meter Comparative Chart

		^			
CAM600S	DCM600DR	DCL31DR	DCM2000DR	DCM400AD	DLC460F
AC (Analog)	DC/AC+True RMS	DC/AC/DC+A	AC,True RMS	DC/AC	Leak Current



				P		
Page	P33	P33	P34	P34	P34	P35
Count	-	6000	6000	6000	4000	6000
Category	-	CATIII 600V	CATIII 300V	CATIV 1000V	CATIII 300V	CATIII 600V
	-				CATII 600V	
CE	-	•	•	•	•	•
True RMS (AC)	-	•	•	•	-	-
Clamp diameter (mm)	36	30	25	55	25	35
Range	М	А	Α	A/M	A/M	А
DCA(A) max	-	600	400	2000	400	-
ACA(A) max	600	600	400	2000	400	400
Resolution (A)	-	0.01	0.01	0.1	0.01	0.01m
DCV(V) max	60	600	-	1000	600	600
ACV(V) max	600	600	-	1000	600	600
Resistance (Ω) max	100k	999.9	-	40M	400	999.9
Capacitance (F) max	-	-	-	$2000~\mu$	-	-
Frequency	-	-	-	•	-	-
Continuity	-	Buzzer	-	Buzzer	Buzzer	Buzzer
Diode test	-	-	-	•	-	-
AutoV Ω	-	-	-	•	-	-
EF detection	-	-	-	•	-	-
Low Pass Filter	-	-	-	•	-	•
Backlight	-	•	•	•	-	•
Auto power off/save	-	Save	Off	Save	Off	Save

145

54

31

120

264

97

43

640

193

50

28

230

206

83

38

320

AC+True RMS

 ϵ

DCL11R (with case)

RMS mini clamp meter with backlight True RMS

■Compact pocket size ■Data hold

Backlight Auto power off (approx.15min.) (cancelable)

Safety: IEC61010-1, IEC61010-2-030 CAT.III300V IEC61010-2-32







HÔLD	LIGHT		
range		Best accuracy	Res
		±(2%+5)	0.01

45~400Hz Bandwidth Conductor size Standard accessories included Carrying case (C-DCL10), Instruction manual



DCM60R (with case)

Low cost & DMM functions

True RMS ■Measurable AC 0.1A~600A ■ACV & Resistance measurement

■Small design & easy to carry Data hold

Continuity check buzzer Sampling rate : approx.2 times / sec.

AC frequency bandwidth: 50~400Hz Safety: IEC61010-1, IEC61010-2-030 CAT.III300V /CAT.II600V, IEC61010-2-032, IEC61010-2-033, IEC61010-31

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2 Test lead : TL-21M, TLF-120

Max 600A RM	S •)) DATA HOLD		
DCM60R	Measuring range	Best accuracy	Resolution
ACA	199.9/600A	±(2%+5)(50~60Hz) ±(2.9%+5)(60~400Hz)	0.1A
ACV	199.9/600V	±(1.5%+5)(50~400Hz)	0.1V
Resistance	199.9 Ω	±(1.0%+8)	0.1 Ω
Continuity	Buzzer sounds at less that	an approx. 100 Ω Open voltage :	approx.1.0V
Bandwidth	50~400Hz		
Display	1999		
Clamp diameter/ Conductor size	25mm / 10 x 30mm		
Battery	R03 x 2		
Size / Mass	H187 x W50 x D29mm /	approx. 210g	
Standard accessories included	Test lead(TL-21a), Carry	ring case(C-DCM60L), Instruct	ion manual



DCM660R (with case)

Suitable for Electric work and air conditioning & DMM functions

■AC current measurable max. 660A True RMS

■Inrush current measurement Max/Min value hold Frequency measurement by clamping and using

test lead ■Data hold, Auto power save LCD with back light

Sampling rate: 3 times / sec. for numeral display Safety: IEC61010-1 CAT.III600V, IEC61010-2-032, IEC61010-031

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2 Test lead : TL-21M, TLF-120

Max 60A	•)







Measuring range	Best accuracy	Resolution
66/660A	± (2%+5)	0.01A
600V	± (1.2%+5)	0.1V
600V	± (1%+2)	0.1V
660 Ω	± (1%+7)	0.1 Ω
660/6.6k/30k	± (0.2%+1)	0.1Hz
660/6.6k/66k/100k	± (0.2%+1)	0.1Hz
Buzzer sounds at less th	an 30 Ω. Open voltage: approx	. 1.2V
50~500Hz		
6600		
6600		
6600 30mm/10×50mm	(approx. 265g	
	66/660A 600V 600V 660 Q 660/6.6k/30k 660/6.6k/66k/100k Buzzer sounds at less th	66/660A ± (2%+5) 600V ± (1.2%+5) 600V ± (1%+2) 660Ω ± (1%+7) 660/6.6k/30k ± (0.2%+1) 660/6.6k/66k/100k ± (0.2%+1) Buzzer sounds at less than 30 Ω. Open voltage: approx

AC+True RMS



DCL1200R (with case)

RMS lightweight & DMM functions

Lightweight approx. 290g True RMS Large LCD with Backlight

■Easy to use large size data hold button ■AC voltage detection function (EF) Auto V / Ω detection MAX. 1200A measurable

Display : numeral display 6000 Sampling rate: 5 times / sec. AC frequency bandwidth: 50 / 60Hz Safety: IEC61010-2-032 CAT. III 600V Max.

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2 Test lead : TL-21M, TLF-120

DCL3000R (with case)

in narrow space

■True RMS

Backlight

ACA Clamp meter with flexible CT

■AC current measurable max. 3000A

Data hold, Max/Min value hold

Sampling rate : approx. 2 times / sec.

Safety: IEC61010 CAT.IV 600V

■Flexibility facilitating conductor clamping even

lax 00A	RMS	







1200A	HIVIS	пZ	וויי	ПГ	(NCV)	0
DATA HOLD	RNG	BACK LIGHT	AUTO VΩ			

DCL1200R	Measuring range	Best accuracy	Resolution
ACA	400/1200A	± (1.7%+5)	0.1A
DCV	6/60/600V	± (0.7%+3)	1mV
ACV	6/60/600V	± (1.7%+5)	1mV
Auto resistance	$6k/60k/600k/6M\Omega$	± (1.2%+4)	1Ω
Resistance	600Ω	± (2.2%+8)	0.1 Ω
Frequency	9.999/99.99/999.9/9.999k/30kHz	± (0.6%+4)	0.001Hz
Capacitance	100n/1000n/10 μ /100 μ /2000 μ F	± (3.7%+5)	0.1nF
Continuity	Buzzer sounds at between 0Ω and 155Ω (±145Ω). Open voltage	e: approx. 0.4\
Diode test	Open voltage: approx. 1.6V		
Voltage detection	Buzzer sounds and EF mark displays on LCD.	Detection range: 20V or	over, 50/60Hz
Bandwidth	ACA: 50/60Hz, ACV: 50~500Hz		
Display	4000		
Withstand voltage	5550VAC		
Battery	R03×2		
Clamp diameter/ Conductor size	42mm/20×54mm		
Size / Mass	H238×W95×D45mm/290a		

Test lead (TL-23a), Carrying case, Instruction manual

+(3%+5)

30/300/3000A

approx. ϕ 150mm max

H120×W70×D26mm/approx. 300g

Carrying case (C-CL3000), Instruction manual

45~500Hz

I Rn3×2

Max 400A Hz •)) DATA AP OFF

Randwidth

Clamp diame

Size / Mass

Conductor size

Display


AC (Analog Type)

AC

 ϵ

CAM600S (with case)

Temperature probe : T-THP Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2













REL

DCL1000	Measuring range	Best accuracy	Resoluti
ACA	400/1000A	± (1.7%+5)	0.1A
DCV	400m/4/40/400/600V	± (1.2%+3)	0.1mA
ACV	400m/4/40/400/600V	± (2.2%+5)	0.1mV
Resistance	$400/4k/40k/400k/4M/40M\Omega$	± (1.2%+4)	0.1 Ω
Continuity	Buzzer sounds at between 0Ω and 6	$65\Omega(\pm 55\Omega)$. Open volta	ge: approx. 0.
Diode test	Open voltage: approx. 1.6V		
Bandwidth	ACA: 50/60Hz (sine wave), AC\	/: 50~500Hz (sine wa	ive)
Display	4000		

Safety: IEC61010-2-032, CAT. III 600V

Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4.TL-A7M.TL-A7M2

Lower cost lightweight & DMM functions

Test lead : TL-21M, TLF-120

■Easy to use large size data hold button

DCL1000 (with case)

Lightweight approx. 290g

Sampling rate: 3 times / sec.

AC frequency bandwidth : 50~500Hz

■Large LCD


Withstand voltage 5550VAC R03X2 Clamp diameter/ 42mm/20×54mm Conductor size Size / Mass H238×W95×D45mm/290n Test lead (TL-23a), Carrying case, Instruction manual

AC600A, AMT functions

■AC current measurable max. 600A Long analog pointer with "pointer lock" function ■Temperature measurement with optional probe

Display : Analog pointer AC frequency bandwidth: 50 / 60Hz

Test lead: TL-21M, TLF-120

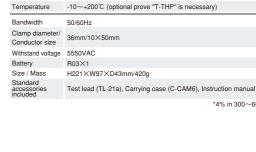

6/15/60/150/600A

150/300/600V

60V

DCV

*4% in 300~600A

 $\pm 3\%$ of full scale*

+3% of full scale

±3% of full scale

AC



DCM400 (with case)

Low cost & DMM functions

■4000 count / 42 segment analog bar graph ■Frequency measurement by clamping and using test lead Data hold

Continuity check buzzer Auto power off (30min.) Low battery power indication

Sampling rate: 2 times / sec. for numeral display AC frequency bandwidth: 50~60Hz (ACA: 1.9%±5), 60~500Hz (ACA:

2.5%±5), 50~500Hz (ACV) Safety: IEC61010-1 (EN61010-1) CAT. III 300V. / CAT. II 600V

Adapter: CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2 Test lead: TL-21M, TLF-120



M400	Measuring range	Best accuracy	Resolution
Α	40/400A	± (1.9%+5)	0.01A
V	400/600V	± (1.5%+5)	0.1V
V	400/600V	± (1%+2)	0.1V
sistance	400 Ω	± (1%+2)	0.1 Ω
equency (A)	20~4k/10kHz	± (0.1%+1)	1Hz
equency (V)	4k/40k/400k/1MHz	± (0.1%+1)	0.01kHz
ntinuity	Buzzer sounds at less than app	rox. 40 Ω. Open voltage :	approx. 1.
-			
ndwidth	50~60Hz (ACA: 1.9%±5) 60 50~500Hz (ACV: 1.5%±5)	~500Hz (ACA:2.5%±5)	,
ndwidth		~500Hz (ACA:2.5%±5),	,
	50~500Hz (ACV: 1.5%±5)	~500Hz (ACA:2.5%±5),	,
play mp diameter/	50~500Hz (ACV: 1.5%±5) 4000	~500Hz (ACA:2.5%±5).	,
play amp diameter/ nductor size	50~500Hz (ACV : 1.5%±5) 4000 25mm/10×34mm	~500Hz (ACA:2.5%±5)	,

Test lead (TL-23a), Carrying case (C-DCM400), Instruction manual

DC/AC+True RMS



DCM600DR (with case)

Suitable for maintenance of vehicle, hybrid vehicle, electric vehicle & DMM functions

■AC / DC current measurable max. 600A True BMS Peak hold (1ms)

■Relative value measurement ■Data hold, Auto power save LCD with back light

Sampling rate: 3 times / sec. for numeral disply, Safety: IEC61010-1 CAT.III600V, IEC61010-2-032, IEC61010-031

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2







Measuring range	Best accuracy	Resolution
60/600A	± (2%+5)	0.01A
60/600A	± (2%+5)	0.01A
600V	± (1.2%+5)	0.1V
600V	± (1%+2)	0.1V
999.9Ω	± (1%+7)	0.1 Ω
Buzzer sounds at less than 40	Ω. Open voltage: approx	x. 2.9V
50~500Hz		
6000		
30mm/10×50mm		
30mm/10×50mm		
30mm/10×50mm LR03×2		
	x. 260g	
	60/600A 600V 600V 999.9Ω Buzzer sounds at less than 40 50~500Hz	60/600A ± (2%+5) 60/600A ± (2%+5) 600V ± (1.2%+5) 600V ± (1.2%+5) 600V ± (1%+2) 999.9 Ω ± (1%+7) Buzzer sounds at less than 40 Ω. Open voltage: approx 50~500Hz

Test lead : TL-21M, TLF-120

32 www.sanwa-meter.co.jp

www.sanwa-meter.co.jp

Clamp Meter

DC/AC/DC+AC,True RMS



DCL31DR (with case)

DC/AC RMS mini clamp meter with peak hold function

■True RMS ■Compact pocket size

Peak hold ■Data hold

Backlight

Auto power off (approx.15min.) (cancelable)

Sampling rate: 2 times / sec. Safety: IEC61010-1, IEC61010-2-030 CAT.III300V IEC61010-2-32

Max 400A	RMS	DCA ACA	PEAK
AP	DATA	BACK	
OFF	HOLD	LIGHT	

DCL31DR	Measuring range	Best accuracy	Resolution
ACA	60/400A	± (2.0%+5)	0.01A
DCA	60/400A	± (2.0%+5)	0.01A
Bandwidth	45~400Hz		
Display	6000		
Clamp diameter/ Conductor size	25mm/10X26mm		
Battery	LR03×2		
Size / Mass	H145×W54×D31mm	/approx. 120g	
Standard accessories included	Carrying case (C-DCL10), Instruction manual		

ϵ

DCM2000DR (with case)

DC / AC current measurable max. 2000A & DMM functions

Dual display shows voltage/current and its frequency ■True RMS

■EF (Electric Field) sensing

■VFD (Variable Frequency Drive) frequency measurement

Low input impedance voltage measurement capable of attenuating the effects of ghost voltage

■Data hold, Range hold

Relative value Peak hold (5ms)

Auto Power Save (30min.) (cancelable)

Sampling rate : approx. 5 times / sec Safety: IEC61010 CAT.IV 1000V











DCM2000DR	Measuring range	Best accuracy	Resolution
ACA	200/2000A	± (2.0%+5)	0.1A
DCA	200/2000A	± (2.0%+5)	0.1A
ACV	6/60/600/1000V	± (1.2%+5)	0.001V
DCV	6/60/600/1000V	± (0.5%+5)	0.001V
Resistance	$600/6k/60k/600k/6M/40M\Omega$	± (0.5%+5)	0.1 Ω
Frequency	10~1999Hz	± (0.1%+4)	0.01Hz
Capacitance	60n/600n/6 μ /60 μ /600 μ /2000 μ F	± (2.0%+5)	0.01nF
Continuity	Buzzer beeps at below the thresh	old (10 to 200 Ω)	
	Open voltage: approx. 0.5V		
Diode test	Open voltage: approx. 1.8V		
Bandwidth	50~400Hz		
Display	6000		
Clamp diameter/			
	55mm/20×66mm		
Conductor size	55mm/20×66mm R6×2		
Conductor size Battery Size / Mass		640g	

Test lead (TL-29), Carrying case (C-DCM2000DR), Instruction manual

Leak current



DLC460F (with case)

Multifunctional lo Leakage Clamp Meter

Low-pass filter function cuts current value of high frequency

Max/Min value hold, Data hold Backlight

Auto power save (30min.)

Sampling rate: 2 times / sec.

Safety: IEC61010-1 CAT.III600V, IEC61010-2-032, IEC61010-031

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2

Max 400A	LEAK	LPF	APS	DATA HOLD	MA M I
DLC460F	Me	asuring ra	ange	Best accura	асу
ACmA	60	m/600mA		±(1.2%+5)	
ACA	60	400A		±(1.2%+5)	
ACV	600	V		±(1.2%+5)	

		-(
ACA	60/400A	±(1.2%+5)	0.01A
ACV	600V	±(1.2%+5)	0.1V
DCV	600V	±(1.0%+2)	0.1V
Resistance	999.9Ω	±(1.0%+8)	0.1 Ω
Bandwidth	40~400Hz		
Display	6000 (V/A), 9999 (Ω)		
Clamp diameter/ Conductor size	35mm/10×40mm		
Battery	LR03X2		
Size / Mass	H206×W83×D38mm/approx. 320g		
Standard accessories	Test lead (TL-23a), Carrying case (C-DCM660), Instruction manual		

Detectors

Voltage Detector



KD3

KS1

Detection with a loud beep and blinking LED

■Slim, easy-to-hold pen-shaped design Sensitivity switchable between HIGH and LOW Safety design equipped with a power LED

KD3	
Detectable voltage range	80 to 600V AC, 50/60Hz HIGH:Works with IV2 mm jacketed electrical wire or equivalent LOW:Works with bare live part
Detection indicator	Red and green LEDs blinks; beep sound
Volume	50dB or more at 50cm distance from beep emitter
Light intensity	Visible at 50cm distance from light emitting section with light intensity of 8,000lux
Dielectric strength	1 min. At 2000V AC, from sensor to grip
Low battery warning	Beep sounds for 2 sec. when voltage falls below approx. 2.4V and then power is turned OFF
Operating temperature /humidity	Temperature: -10 $^{\circ}\text{C}$ to 45 $^{\circ}\text{C}$; humidity: 80% RH or less (no condensation)
Battery	LR44 (1.5V) X 2
Size/Mass	H134XW20XD18/approx. 20g
Standard accessories included	LR44 (alkaline button battery) X 2, Instruction manual

DC/AC



DCM400AD (with case)

Suitable for automotive maintenance & **DMM functions**

■4000 count / 42 segment analog bar graph ■DC / AC current 40A/400A

■Data hold / Range hold Relative value

Continuity check buzzer Auto power off (30min.)

Low battery power indication

Display: numeral display 3999, bar graph 42 segments Sampling rate: 2 times / sec. 20 times / sec. for bar graph AC frequency bandwidth : 50~500Hz Safety : IEC61010-1 (EN61010-1) CAT. III 300V / CAT. II 600V

Adapter : CL-13a, CL-14, CL-15a, CL-DG3a, TL-9IC TL-A4,TL-A7M,TL-A7M2

Test lead : TL-21M, TLF-120













		٦
	REL	
Ц		


DEI	
NEL	

	REL	
--	-----	--

REL

DCM400AD	Measuring range	Best accuracy	Resolution
ACA	40/400A	± (2%+10)	0.01A
DCA	40/400A	± (2.5%+10)	0.01A
ACV	400/600V	± (1.5%+5)	0.1V
DCV	400/600V	± (1%+2)	0.1V
Resistance	400 Ω	± (1%+2)	0.1 Ω
Continuity	Buzzer sounds at less than appro	ox. 40 Ω. Open voltage:	approx. 1.5V
Bandwidth	50∼500Hz		
Display	4000		
Clamp diameter/ Conductor size	25mm/10×34mm		
Withstand voltage	Less than 3700Vrms		
Battery	LR03×2		
Size / Mass	H193×W50×D28mm/approx. 230g		
Standard accessories	Test lead (TL-23a), Carrying case (C-DCM400), Instruction manual		

3phase Detector



Safety: IEC61010 CAT. III 500V





KS3

Motor rotation direction testable

■ Phase sequence and open phase checking of three-phase lines

■ Rotation direction check by turning three-phase motor shaft manually ■ Bright LED indication

Safety: IEC61010-1 CAT.III 500V, IEC61557-1,7, IEC61010-2-030, IEC61010-031, IEC61326-1

Voltage range	3 phase AC 100V - 500V
Frequency	45Hz~70Hz
Time limit	AC110V: Continuous, AC220V: 3 hours, AC480V: 12 minutes
Fuse	Φ5×20mm, 0.5A/500V
Environment condition	Altitude 2000m or below, pollution degree II
Operating temperature /humidity	0°C ~40°C, 80%RH max. no condensation
Size	Main unit H102×W78×D32.5mm Alligator clips Approx. 0.8m (Red, White and Blue)
Mass	Approx.212g (Alligator clips included)
Standard accessories included	Carrying case (C-KS)×1, Instruction manual

KS3	
Measurement	Motor rotation direction, open phase and phase sequence
Voltage range	3 phase, line voltage: AC75~500V (sine wave, continuous)
Frequency	40Hz~400Hz
Motor rotaiton direction	Determined at rotation speeds from 2Hz (2 rotations/sec.) to 400Hz
Battery	6LR61(9V)×1
Size / Mass	H128×W72×D38mm/approx. 210g
Standard accessories included	Alligator clips(CL-KS), Test lead(TL-KS), Instruction manual, Carryig case(C-KS2)

Voltage Detector Supporter



KDP₁₀

Alarm device to prevent erroneous cutting of live wire, which can be attached to the cable cutting tool afterwards

- Attachable to your manual cable cutter Warns the live-wire status of a cable with a buzz
- and LED
- Detectable with gloves on
- Approx. 5 months of battery life in standby mode

KDP10	
Detectable voltage level (representative value)	Approx.AC60V to 600V 50Hz/60Hz (attached on 7"/8" cutting tool grip part)
Indication method	Intermitten buzzer/LED illumination
Target cable	Sheathed cable (unshielded cable)
Battery	LR44 (1.5V) X 2
Size/Mass	H23XW77XD13mm Approx.13g (without batteries)
Standard accessories included	Rubber ring (M) X2, (S) X2, Sensitivity control volume cover X2 (spares), LR44 (coin batteries) X2, Instruction manual

KDP10 repair set

(rubber ring (M) X2, (S) X2,sensitivity control volume cover X2, battery holder)

Illuminance Meter

Various environments need appropriate illumination, whether it be ordinary homes, offices, or factories. Inadequate illumination or too much illumination can lead to false recognition, reduced work efficiency, and loss of vision caused by fatigue. Since appropriate illumination helps to improve work efficiency and assure work safety, the control

of illumination is regarded as a very important element. The illuminance meter indicates, by values in the unit of LUX, how much light shines on each place. It is used for the purpose of assuring appropriate illumination suitable for every environment. JIS (Japanese Industrial Standards) has a standard given below as recommended values for each environment.

Туре	LUX 15	00 70	00 30	00 15	50 7	70 3	0	15 -Ll	JX-
Housing		*Sewing (Dark material)	*Studying, Sewing *Reading (Long time or small letters)	* Reading * Makeup * Eating meal	Living room, child room, reception room, dining room, kitchen	Hall, stairway, corridor, escape stairway, garage			
School		* Precision drawing * Machine-sewing * Precision experiment	Drafting room *Blackboard *Sewing *Library reading room *Precision machining	Ordinary classroom, special classroom, library reading room	Auditorium, meeting room, hallway, stairway	Escape stairway			
Office		*Designing *Drawing *Typing *Calculation *Key-punching	Office, drafting room, gage board, telephone exchange room, distribution board	Executive room, conference room, reception room, hall, elevator	Work room, change room, stairway, warehouse	Escape stairway			
Road, park					Tunnel of expressway (Illumination at the entrance and exit should be higher than this value.)	70∼15 Tunnel		15∼3 Road with busy traffic	1.5∼0.3 Road with scarce traffic, road in residential areas,
Hospital	Surgical table 10,000 over	* Autopsy * First-aid treatment * Drug formulation	Surgical room, first-aid station, ocular inspection, drug preparation *Technological research *Injection	Clinic, examination room, dispensary, waiting room, medical office	Doctor's room, hospital room, X-ray room, medicine room				park, other open spaces
Theater, movie theater				*Ticket counter, doorway, back stage	Projection booth, corridor, stairway	Spectators' seat (during a break), escape stairway, garden		3~1.5 Spectate	ors' seats (while showing)
Inn, hotel			Accounting office	Front desk, dining room	Guest room, amusement hall, corridor, lobby				
Diner, restaurant			*Sample case	*Register, kitchen, *dining table	Guest room, waiting room hallway				
Beauty parlor, barber			*Hairdo *Hair setting *Makeup	*Hairdo, *dressing	In shop				
Shop		*Highlighted display in show window *Highlighted show case	* Highlighted display in shop * Show window, ordinary show case	Ordinary display of shop Overall shop					
Department store		*Show window, main part on the 1st floor *Highlighted show case	Ordinary display Ordinary show case	Atmospheric display					

The combined use of local illumination is allowed in places marked with *. In these cases, it is desirable that the overall illumination should be 1 / 10 or more of the illumination by the local illumination

· Each country has it's own standard. Please check the standards for your own country

Pocket Size



LX20

Wide measuring range 0.1lx to 403.9klx

- Separate, stick-shaped light sensor ■ 4039 full-scale count with bar graph
- Silicon photodiode
- Data hold
- Auto power save (15min.)
- Sensor cord length 0.9m
- Si photodiode(\$\phi\$ 9mm) 400.0/4000/40.00k/400.0klx numeral display 4039.bar graph41 segments 3 times/sec., 30 times/sec. for bar graph Sampling rate ±(5%+1) at 3000lx or less +(7.5%+1) at 3000lx or more Compatible JIS standard A Class, 23°C ±2°C Temperature drift ±5% at 23°C within 0°C ~40°C Relative spectral sensitivity Approximating the standard luminous efficiency Sensor probe: H84XW16XD10mm Standard accessories included Instruction manual

APS

Laser Power Meter

Laser power meters

Laser power meters are measuring instruments that let a laser beam emitted from a laser light source enter the sensor light receiver and indicate the value by converting light energy into electric signals. The unit used for this purpose is W (watt). The laser power meter is used for checking the light power of and maintaining laser-operating equipment. Since silicon photo diode used at the receiver of the laser power meter has different photoelectric conversion ratios according to the wavelength of the light received, it needs to be calibrated by the measuring wavelength.

* It is possible to obtain approximate value for the measuring wavelength based on a spectral sensitivity characteristic graph of the silicon photo diode.

- ■830nm Infrared semiconductor laser ■ 780nm Infrared semiconductor laser (e.g. Used for CD player, MD recorder,
- 670nm Visible semiconductor laser
- 633nm He-Ne laser, red semiconductor laser (e.g. Used for DVD player, bar-code
- 532nm Green laser
- 405nm Purple-blue laser

Laser Power Meter (Pocket Size)



LP10

Optical power up to max. 40.39mW measurable Direct reading wavelength customization

 \blacksquare Wide measuring range from 0.01 μ W to 40.39mW

- Silicon photodiode with diffusion sheet
- Sensor can be stored in the main body
- Max / Min hold
- Auto power save (15min)
- Sensor cord length 0.5m when extended

Wavelength customization
The standard LP10 is calibrated at 633 nm but can also read any other wavelength in the 400~1100 nm range using a chart

We can calibrate directly to any other 400~1100 nm wavelength for special orders, with one month lead time, so please contact our authorized agent if necessary.





Light sensor element Si photodiode(\$\phi\$ 9mm) with diffusion shee Measurable wavelength range 400nm~1100nm 633nm (He-Ne laser Other wavelengths should be converted using typical correction factor 40.00 μ/400.0 μ/4.000m/40.00mW numeral display 4039, bar graph 41 segments Sampling rate 3 times/sec..30 times/sec. for bar graph ±5% (in the 4mW range, at the reference vavelength of 633nm and 1mW) 23°C±2°C LB44 (1.5V) X 2 H177XW76XD18mm/approx.120g Size / Mass

CE

LCR Meter

LCR Meter



LCR700

Useful for sorting device value

- Measuring Frequency DC~100kHz Ls/Lp/Cs/Cp measurement with sub parameters(D/Q/ θ /ESR)
- Automatically selectable L/C/R measurement ■ Device sorting mode
- Optical link USB interface (optional) ■ Data hold, Back light

Sampling rate: 1.2 times / sec. (LCR mode) 0.5 times / sec. (DCR mode)

Optical link cable unit : LCR-USB SMD clip lead : CL-700SMD AC adapter : AD-30-2 Carrying case: C-PC7









LCR700	Measuring range	Best accuracy
Ls/Lp	$20.000~\mu/200.00~\mu/2000.0~\mu/20.000 m/20.00 mH \\ 2000.0 m/20.000/200.00/200.00/20.000 kH$	±(0.3%+3)
Cs/Cp	200.00p/2000.0p/20.000n/200.00n/2000.0nF	±(0.3%+3)
Rs/Rp	$20.000/200.00/2.0000k/20.000k\Omega$ $200.00k/2.0000M/20.000M/20.000M\Omega$	±(0.3%+3)
Ω	200.00/2.0000k/20.000k/200.00k Ω 2.0000M/20.000M/200.0M Ω	±(0.3%+3)
Battery	6LF22 (9V) ×1	
Size / Mass	. ,	
Size / Mass	H184×W87×D45/approx. 400g	

Standard accessories Clip lead (CL-700a), Holster (H-701),

 ϵ

www.sanwa-meter.co.jp

Tachometer/Speedometer

Tachometer

SE300

Non-contact type digital tachometer



HOLD OFF	AVG	НТ	
SE300	Non-contact	Contact (optional ENC-3)	Best accuracy
rpm	30.0~99999	30.0~19999	
rps	0.50~1600.0	0.50~333.00	
ms	0.600~1999.0	3.000~1999.0	±(0.03%+1)
count	0~99999	0~99999	±(0.03 /6+1)
m/min	-	3.0~1999.0	
m/s	-	0.05~33.00	
Detection distance	Approx. 50~50	00mm	
Battery	R6P/LR6X2		

H210XW60XD55mm/approx. 218g

Reflective sticker(SE-T3), Carrying case(C-SE300),

DATA AP MAX BACK

Reflective sticker(50stickersX2sheets): SE-T3 Contact measurement attachment : ENC-3 Contact marker : SE-A30 Rim speed ring: SE-A31




Purpose of earth resistance

Earth Testers

When some extraordinary cases occur, obtained this way includes not only the fault current and overcurrent may cause damages to equipment or a risk to humans because the equipment is not grounded. To prevent such risks, grounding plays an important role to assure safety. Grounding provides an escape way to electricity from an electric appliance through metal rod driven into the ground. After grounding works are performed to prevent hazards and assure safety, the earth resistance is measured. To measure the earth resistance, two grounding rods are stuck into the ground. Assuming that two rods are E and C, AC current I is applied between E and C. The earth resistance can be measured from the voltage generated between E and C. The relation between the current I and voltage V is expressed as follows. From this the earth resistance can be obtained. However, the earth resistance R

earth resistance at the grounding electrode E but also the earth resistance at the grounding electrode C. If a third grounding electrode P is provided between the grounding electrodes E and C. the earth resistance RE at the grounding electrode E alone can be obtained from the current I and voltage Vp between E and C.

* Although the grounding electrode P, too, has a resistance zone, it hardly affects the measurement because the impedance of the power supply of AC constant current is high.

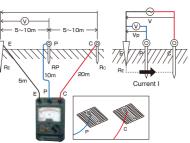

Arrangement of grounding rods

Three-electrode method

Arrange the earth E and auxiliary grounding rods P and C in a straight line at intervals of about 5 to 10m.

* If they cannot be arranged in a straight line because of the presence of an obstacle, arrange E-P and E-C at angles of about 30 degrees or less.

Two-electrode method

If an earth E whose grounding resistance is known is present nearby, the unknown grounding resistance can be measured by using it. Connect the terminal E of the earth resistance meter and the earth E by a cord. Measurements are taken between E and P / C assuming P and C terminals as one terminal

- * The indicated value includes the known resistance value of the earth E. Subtract the grounding resistance of E to obtain the true
- \triangle Sand, gravel and frozen soil \rightarrow Expose soil.
- △ Concrete → Use a net. Flush enough water on the net to let it have a close contact with the ground.
- X Asphalt → Cannot be measured.

Speedometer



●Remote control by SE9100

SE9100

For elevator maintenance, 2ch display

resistance tester M53

by using SE-L-O on the LCD of M53

- Suitable for elevator speed measurement of high building
- Analog output terminal to record measuring data 2 external hold terminals for remote control
- Memory function (max.10sets data)
- Averaging count function
- Easy to read LED displays
- Auto power off (3min.) (extendable to 1hr.)

ATA	WAX
OLD	AVG

Measuring range	Linear velocity: 0.1 ~ 2000.0 (m/min) Rotation speed: 1 ~ 20000 (r/min) Distance: 0 ~ 999 (mm)
Accuracy	$\pm 2dgt$
Sampling time	0.2 sec.
Measuring time	0.01 sec.
Analog output	DC0 \sim 2V Analog output accuracy: $\pm (0.8\% + 2\text{mV})$
Data hold	CH1/CH2/Max. value Independent functions CH1/CH2: Hold by main unit panel or external triggering
Battery	LR6X4
Size / Mass	H174XW50XD50mm/approx.510g
Standard accessories included	Speed ring thickness 10mm (SE-10)X1 Speed ring thickness 0.9mm (SE-0.9)X1 Hold input cable (SE-L-H)X2 Analog output cable (SE-L-O)X1 Hex wrenchX1, Carrying case (C-SE)X1

Analog Type



PDR302

■Phase detection system circuit for stable

Easy self calibration

■AC 30V range to avoid indication errors caused by leak current

Power saving design with push switch



Earth resistance measuring range 10/100/1000 Ω Accuracy: X1 range ±5% of full scale : X10, X100 range ±2.5% of full scale : X10, X100 range ±2.5% of full scale O~30V Measuring range Display Accuracy ±2.5% of full scale Analog Operation Constant current system (tripolar or bipolar) Battery B6P(1.5V) X 6 Size / Mass H175XW118XD55mm/Approx. 500g Measurement cord (TL-66), Clip adapter (CL-302), Earth bars (CL-ER), Carrying case (C-PDR302), Storage case (C-302CB), Instruction manual	PDR302	
Earth resistance measuring range Accuracy: X1 range ±5% of full scale : X10, X100 range ±2.5% of full scale ACV (leakage voltage) O~30V Accuracy ±2.5% of full scale Display Analog Operation Constant current system (tripolar or bipolar) Battery R6P(1.5V) X 6 Size / Mass H175 XW118 XD55mm/Approx. 500g Standard Measurement cord (TL-66), Clip adapter (CL-302), accessories included Earth bars (CL-ER), Carrying case (C-PDR302),	PDR302	
measuring range Accuracy ±2.5% of full scale Display Analog Operation Constant current system (tripolar or bipolar) Battery R6P(1.5V) × 6 Size / Mass H175×W118×D55mm/Approx. 500g Standard Measurement cord (TL-66), Clip adapter (CL-302), accessories included Earth bars (CL-ER), Carrying case (C-PDR302),		Accuracy : X1 range ±5% of full scale
$ \begin{array}{llllllllllllllllllllllllllllllllllll$	ACV(leakage voltage)	0~30V
	measuring range	Accuracy ±2.5% of full scale
Battery R6P(1.5V) × 6 Size / Mass H175×W118×D55mm/Approx. 500g Standard Measurement cord (TL-66), Clip adapter (CL-302), accessories included accessories included Earth bars (CL-ER), Carrying case (C-PDR302),	Display	Analog
Size / Mass H175×W118×D55mm/Approx. 500g Standard Measurement cord (TL-66), Clip adapter (CL-302), accessories included Earth bars (CL-ER), Carrying case (C-PDR302),	Operation	Constant current system (tripolar or bipolar)
Standard Measurement cord (TL-66), Clip adapter (CL-302), accessories included Earth bars (CL-ER), Carrying case (C-PDR302),	Battery	$R6P(1.5V) \times 6$
accessories included Earth bars (CL-ER), Carrying case (C-PDR302),	Size / Mass	H175×W118×D55mm/Approx. 500g
		Earth bars (CL-ER), Carrying case (C-PDR302),

Digital Type



CE

PDR4000

Three measurement ranges: 40Ω , 400Ω , 4000Ω 3-pole/2-pole earth resistance measurement *Optional accessory TL-68 is necessary for 2-pole measurement.

■Data hold

Backlight Relative value

Auto power off (10min.) (cancelable) Capable of measuring interference voltage

Display: numeral display 4000 Sampling rate: 2times/sec Safety: IEC61010-1 CAT.II 400V/CAT.III 300V







PDR4000	Measuring range			
	40 Ω	$0.00{\sim}10.00\Omega$	±(2%+10)	
Earth resistance		$10.01 \sim 40.00 \Omega$	±(2%+3)	
measuring range	400 Ω	$0.0{\sim}400.0\Omega$	±(2%+3)	
	4000 Ω	0~3000Ω	±(2%+3)	
ACV	0~400V		±(2%+3)	
Display	Digital			
Measuring system	Constant current inverter 820Hz, approx.2mA			
Battery	R6P(1.5V) × 6			
Size / Mass	H163×W102×D50/Approx.440g			
Standard	Test lead set(TL-67),			
accessories included Auxiliary earth electrode X 2(CL-ER4000),			R4000),	
	Carrying case(C-P	DR4000). Instruc	ction manual	



www.sanwa-meter.co.jp

Measuring data can be remotely held by using SE-L-H cable.

Assembly Training Kits

Sanwa assembly training kits have been developed for educational uses. These assembly training kits are available for purchase from our agents only.

Analog type

Complete image

KIT-8D

Learning kit designed for measurement of small capacity electric circuits

- Drop shock proof taut-band meter
- Battery check
- Meter zero adjuster Zero Ω adjuster
- Protective body cover







KIT-8D	Measuring range	Accuracy
DCV	0.3/3/12/30/120/300/600V (20kΩ/V)	±3% of full scale
ACV	12/30/120/300/600V (9kΩ/V)	±4% of full scale
DCA	60 μ/3m/30m/0.3A	±3% of full scale
Resistance	20/200/20kΩ	±3% of arc
Battery check	1.5V	
Bandwidth	50 or 60Hz (sine wave)	
Battery	UM-3(1.5V)×2	
Fuse	φ 5.2×20mm (250V/0.5A)	
Siza / Macc	H159 5 X W129 X D41 5mm/approx 320g	



Digital type



Complete image *Holster is optional

PC20TK

General-purpose DMM kit

- 3-3/4 digits 4000 count
- Capacitance measurement (40nF \sim 100 μ F)
- Data hold / Range hold
- \blacksquare Safety cover for the $\mu A \cdot mA$
- Tilt stand Optical link RS232C / USB interface(optional)
- Display : numeral display 4000
- Sampling rate: 3 times / sec.









PC20TK	Measuring range	Best accuracy	Resolution	Input impedance		
DCV	400m/4/40/400/750V	±(1.0%rdg+2dgt)	0.1mV			
ACV	4/40/400/750V	±(1.5%rdg+5dgt)	0.001V	DCV:		
DCA	400 μ/4000 μ/40m/400m	±(1.5%rdg+2dgt)	0.1 μ Α	10M~		
ACA	400 μ/4000 μ/40m/400m	±(2.0%rdg+5dgt)	0.1 μ Α	100M Ω		
Resistance	400/4k/40k/400k/4M/40M	±(1.5%rdg+5dgt)	0.1Ω	ACV:10M		
Capacitance	50n/500n/5 μ/50 μ/100 μF	±(7%rdg+6dgt)	0.01nF			
Continuity	Buzzer sounds at between 10Ω and 120Ω . Open voltage: approx. 0.4V					
Diode test	Open voltage: approx. 1.5V					
Bandwidth	40~400Hz (sine wave)	40~400Hz (sine wave)				
Fuse / Battery	0.5A/250V IR300A & 6.3X30mm R6×2					
Size / Mass	H158×W70×D41mm/230g					
Standard accessories	Test lead (TL-21a), Instru	iction manual				

Software : PC Link7 Optical PC Link cable : KB-USB20 Temperature probe : T-300PC(PC Link software is necessary.) Clip adapter : CL-11, CL-13a, CL-15a, CL-DG3a, TL-8IC



Calibrator

Calibrator

STD5000M (Order production)



The STD5000M is a calibrator with soft touch buttons that can generate a desired DC voltage / current, AC voltage / current, resistance, frequency, etc. with a high degree of accuracy and stability.

The STD5000M is with a memory function allowing a broad range of uses for the

Ranges

- Voltage(DC·AC): 0~1000V(6 ranges)
- Current(DC·AC) : 0~2000mA(6 ranges)
- Resistance1 : 0~500kΩ(10Ω steps)
- Resistance2: 24 steps fixed resistance value(4 kinds 6 ranges)
- Hz: 40Hz~999kHz(5 ranges)

■ High accuracy 0.03% (DCV DC mA)

Reliable accuracy is achieved by using the standard voltage IC with a constant-temperature bath for the reference voltage and wire wound resistor and metal film resistor with high tolerance and low temperature coefficient for

■ Calibrates 6 types of functions

With the calibration elements of 6 functions(DCV, ACV, DCA, ACA, OHM, Hz) incorporated, it can be used for calibrating and maintaining the DMM, DPM (digital power meter), circuit tester and industrial instruments.

■ Installs 90 (6x15) output memories

With 90 (6x15) output memories installed, it is possible to save desired setting. User-friendly speedy operability

Use of soft-touch push button switches for operation on the panel(except the power switch). Use of semiconductor switches with greater heat resistance and durability for change switches of the circuit, and latch-type relays requiring less electro motive force.

■ With overload protection device

To enhance security, overload protection in case of low voltage and current generation is performed on the semiconductor circuit, and overload protection in case of medium and high voltage generation(50V or more) is achieved by releasing the output terminal and circuit.

STD5000M	Measuring range	Generation range	Resolution	Set accuracy	Maximum load					
DCV	50mV 500mV 5V 50V 500V 1000V	0~50mV 0~500mV 0~55V 0~50V 0~500V 0~1000V	1 μV 10 μV 100 μV 1mV 10mV 100mV	$\begin{array}{l} \pm (0.05\% + 30 \ \mu \ V) \\ \pm (0.03\% + 30 \ \mu \ V) \\ \pm (0.03\% + 200 \ \mu \ V) \\ \pm (0.03\% + 200 \ \mu \ V) \\ \pm (0.03\% + 200 \ W) \\ \pm (0.03\% + 200 \ W) \\ \pm (0.05\% + 0.3 \ V) \end{array}$	10mA					
ACV	50mV 500mV 5V 50V 50V 1000V	0~50mV 0~500mV 0~500mV 0~5V 0~50V 0~500V 0~1000V	1 μV 10 μV 100 μV 1mV 10mV 100mV	\pm (0.1%+50 μ V) \pm (0.06%+100 μ V) \pm (0.06%+0.4mV) \pm (0.06%+40MV) \pm (0.06%+40mV) \pm (0.1%+0.4V)	10mA					
DCA	50 μ A 500 μ A 5mA 50mA 500mA 2000mA	0~50 μ A 0~500 μ A 0~500 μ A 0~5mA 0~50mA 0~500mA 0~2000mA	1nA 10nA 100nA 1 μ A 10 μ A 100 μ A	\pm (0.05%+30nA) \pm (0.05%+30nA) \pm (0.05%+0.2 μ A) \pm (0.05%+0.2 μ A) \pm (0.05%+20 μ A) \pm (0.1%+300 μ A)	13V (Open circuit voltage)					
ACA	50 μ A 500 μ A 5mA 50mA 500mA 2000mA	$0\sim50~\mu\text{A}$ $0\sim500~\mu\text{A}$ $0\sim5\text{mA}$ $0\sim50\text{mA}$ $0\sim500\text{mA}$ $0\sim2000\text{mA}$	1nA 10nA 100nA 1 μ A 10 μ A 100 μ A	$\begin{array}{l} \pm (0.12\% + 60 \text{nA}) \\ \pm (0.12\% + 80 \text{nA}) \\ \pm (0.1\% + 0.5 \mu\text{A}) \\ \pm (0.1\% + 5 \mu\text{A}) \\ \pm (0.1\% + 50 \mu\text{A}) \\ \pm (0.15\% + 0.5 \text{mA}) \end{array}$	13V (Open circuit voltage)					
OHM1 Frequency		$\begin{array}{l} 0\!\sim\!500k\Omega\\ 0.1Hz\\ 1Hz\\ 10Hz\\ 100Hz\\ 1kHz(Rectangularwave)\\ 0.1V \end{array}$	10 Ω - - - - -	- ±(0.1%+0.1Hz) ±(0.1%+1Hz) ±(0.1%+10Hz) ±(0.1%+10Hz) ±(0.1%+100Hz) ±(0.1%+1kHz) ±(2%+0.2V)	- - - -					
STD5000M	Measuring range	•		Accuracy						
OHM2	160/260/360/4 1.6k/2.6k/3.6k/ 16k/26k/36k/4t 160k/260k/360 1,600k/2,600k/ 16M/26M/36M/	4.6k Ω 6k Ω k/460k Ω (3,600k/4,600k Ω	$\begin{array}{l} \pm (0.05\% + 0.1\Omega) \\ \pm (0.05\%) \\ \pm (0.05\%) \\ \pm (0.05\%) \\ \pm (0.05\%) \\ \pm (0.05\% \sim 0.08\%) \\ \pm (0.05\% \sim 0.2\%) \end{array}$							
Memory	6×15(90)									
Max. display	4-1/2 digit(exc 50099 LOCAL(surface 23°C±3°C belo 30~60m. AC100V±10%	w 70%RH	OmA,OHM	2)						
Power	30VA	, 55.12, 55112								
consumption		r higher AC ranges	· Overload	d protection						
Protection	DC and 50 V or higher AC ranges: Overload protection device with reset switch. DC and 5 V or lower AC ranges: Overload protection circuitry.									
Size / Mass Standard	H180×W480>	(D580mm/25kg								

	Model								TEST	LEAU										Model				CLIP ADAPTER	1			I CONNECTO	HIGH VOLTAGE IR PROBE				URE SENS	JUN
Model		TL-11Ta	TL-21a	TL-21M	TL-23a	TL-25a	TL-29	TL-61	TL-61	IT TL-91	TL-9	1M TL-112a	TL-5099	TL-M54	TL-100-0	I TL-PM3	TLF-120	1	Model		_	CL-14	CL-15a	CL-DG3a TL-910	C TL-A4	TL-A7M	TL-A7M2			T-THP				K-8-250/500/650/800
	CD731a	-	0	•	-	-	-	-	-	-	-	-	-	-	-	-	•			CD731a	•	•	•	• •	•	•	•		HV-60		-	-	-	-
	CD732		•	•	•	0											-		CD732	•	•	•		•	•	•		HV-60					-	
	CD770		0			•							-	-						CD770		•	•	• •	•	•		_	-				_	
					0																													
	CD771		•	_	0	0											-			CD771								_				-		-
	CD772	-	-	-	-	0	-	-	-	-	-	-	-	-	-	-	•			CD772	•	•	•	•	•	•	•	-	HV-60	-	-	O	-	•
	CD800a	-	-	-	-	-	-	-	TL-61	Ta -	-	-	-	-	-	-	-			CD800a	-	•	•	• •	-	-	-	-	-	-	-	-	-	
	DA-50C	-	-	-	-	-	-	0	-	•		-	-	-	-	-	-			DA-50C	-	•	•	• •	-	-	-	-	-	-	-	-	-	-
	PC20	-	0	•	•	•	-	-	-	-	-	-	-	-	-	-	•			PC20	•	•	•	• •	•		•	-	-	-	•	-	-	-
	PC500a	-	•	•	0		-	-	-	-	-	-	-	-	-	-	•			PC500a	•	•	•	• •	•	•	•	-	-	-	•	-	-	-
	PC5000a	-	•	•	0	•	-	-	-	-	-	-	-	-	-	-	•			PC5000a	0	•	•	• •	•	•	•	-	-	-	•	-	-	-
Digital	PC510a	-	•	•	0	•	-	-		-		-	-	-	-	-	•		Digital	PC510a	•	•	•	• •	•	•	•	-	-	-	•	-	0	•
Multimeter	PC520M	-	•		•												•	Multimeter PC	PC520M	0	Δ	Δ	Δ Δ	Δ	Δ	Δ	-		-			0	•	
	PC700																		PC700					•	•		_		_					
	PC7000	-			0		-	-	-	-	-	-	-	-	-	-													-	-		-	0	
			•	-	0												•			PC7000	•				•		•	-			•			
	PC710	-	•	•	0	•	-	-	-	-	-	-	-	-	-	-	•			PC710	•	•	•	•	•	•	•	-	-	-	•	-	0	•
	PC720M	-	•	•	0	•	-	-	-	-	-	-	-	-	-	-	•			PC720M	•	•	•	• •	•	•	•	-	-	-	•	-	0	•
	PC773	-	•	•	•	0	-	-	-	-	-	-	-	-	-	-	•			PC773	•	•	•	• •	•	•	•		-	-	•	-	-	-
	PM3	-	-	-	-	-	-	-	-	-	-	-	-	-	-	0	-			PM3	•	-	•		-	-	-	-	-	-	-	-	-	-
	PM33a	-	-	-	-	-	-	-	-	-	-	-		-	-	-	-			PM33a	•	•	•	• •	-	-	-	-	-	-		-	-	-
	PM7a/PS8a	-	-		-	-	-	-	-	-	-	-	-	-	-					PM7a/PS8a	-	•	•		-	-	-		-			-	-	-
	PM11	0							_		-			-						PM11				• .					-					
	RD700/701	-			0	•				_		_		_	-	-				RD700/701	•	•				•	•		HV-60			_	0	•
	CAM600S		0			-											-		-	CAM600S		-		•		•	-		114-00	-		-		
		-	O	•	•	•	•	•	-	•	-	•	-	-	•	-	•					•		• •			•	-	•		•	•	-	-
	DCL11R/30DR	-		-	-		-	-	-	-	-	-	-	-	-		-			DCL11R/30D							-		-			-		
	DCL1000/1200R	-	•	•	0	•	-	-	-	-	-	-	-	-	-	-	•			DCL1000/120		•	•	• •	•	•	•	-	-	-	-	-	-	-
	DCL3000R	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-			DCL3000R	-	-	-		-	-	-	-	-	-	-	-		
	DCM-22AD	-	-	-	-	-	-	0	-	•	•	-	-	-	-	-	-			DCM-22AD	-	•	•	- •	-	-	-	-	-	-	-	-	-	-
	DCM2000	-	•	•	•		-	-	-	-	-	-	-	-	-	-	•			DCM2000	•	•	•	• •	-	-	-	-	-	-	-	-	-	-
	DCM2000AD		0																	DCM2000AI	D .													
	DCM2000R	-	0	•	•	•	•	-	-	-	-	•	-	-	-	-	•			DCM2000R	•	•		• •	-	-	-	-	•	-	-	-	-	-
Clamp	DCM2000DR	-		-		-	0						-	-			-		Clamp	DCM2000DI										-			-	-
/leter	DCM400/AD				\circ		-												Meter	DCM400/AD					•	•		_		_				
	DCM60L	_			0		_	_	_	_	_	_	_	_	_	_				DCM60L									_	_	_	_		
		-			0		-	-					_	-	-									•				_	-	-		-		
	DCM60R	-	0	•	•	•	-	-	-	-	-	-	-	-	-	-	•			DCM60R	•	•	•		•	•	•	-	-	-	-	-	-	-
	DCM600DR	-	•	•	O	•	-	-	-	-	-	-	-	-	-	-	•		DCM600DF		•	•	• •	•	•	•	-	-	-	-	-		-	
	DCM660R	-	•	•	0	•	-	-	-	-	-	-	-	-	-	-	•			DCM660R	•	•	•	• •	•	•	•	-	-	-	-	-	-	-
	DLC-330L	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		DLC-330L	-	-	-		-	-	-	-	-	-	-	-		-	
	DLC-400A	-	•	•	•	•	-	0	-	•	•	-	-	-	-	-	-		DLC-400A	-	•	•	• •	-	-	-	-	-	-	-	-	-	-	
	DLC460F	-	•	•	0	•	-	-	-	-	-	-	-	-	-	-	-		DLC460F	•	•	•	• •	•	•	•	-	-	-	-	-	-	-	
	DG6/7/8/9/10	0	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-			DG6/7/8/9/1	0	-	0	• -	-	-	-	-	-	-	-	-	-	-
	DG251													0		_	_			DG251				_		_								
	DG525	-	-	-	-	-	-	-	-	-	-	•	-	0	-	-	-			DG525	-	-	-		-	-	-	-	-	-	-	-	-	-
	DM1008S	-	-	-	-	-	-	-		-		-	•	-	-	-	-		DM1008S	-		-			-	-	-	-	-	-	-	-	-	
	DM1009S	-		-		-							0	-			•		DM1009S			-					-		-					
	DM1528S																			DM1528S			_			_								
	DM5218S	-	-	-	-	-	-	-	-	-	-	-		-	-	-		()	()	DM13283		-				_	-		-	-	-	-	-	
nsulation													•				•		Insulation															
Ta adam	OM508S/ PDM508		-	-	-	-	-	-	-	-	-	-		-	-	•			Tastan	DM508S/PDM5		-	-		-		-	•	-	-	•	-	-	-
	DM509S/PDM509S	5 -	-	-	-	-	-	-	-	-	-	-	0	-	-	-	•		163(6)	DM509S/PDM5		-	-		-	-	-	-	-	-	-	-	_	
	PDM1529S	-	-	-	-	-	-	-	-	-	-	-	0	-	-		•			PDM1529S		-	-		-	-	-	-	-	-		-	-	-
	PDM5219S	-	-	-	-	-	-	-	-	-	-	-	0	-	-	-	•			PDM5219S	-	-	-		-	-	-	-	-	-	-	-	-	-
	HG561H	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-			HG561H	-	-	-		-	-	-	-	-	-		-	-	-
	M53	-	-		-	-	-	-	-	-	-	-	-	0	-					M53	-	-	-		-	-	-		-			-	-	-
	MG1000	-	-		-	-	-	-		-		0		-	-					MG1000	-	-	-		-	-	-		-			-	-	
	MG500/125	_									_	0		-			•			MG500/125			-		-	-								-
	AP33	-	-	_											-					AP33			_									_	-	
					-			_		_				-															-			-		
	AU-31/32	-	-	-	-	-	-	U	_	•	•	-	-	-	-		-			AU-31/32	-	•		•	-		-		-			-	_	
	CP-7D	-	-	-	-	-	-	-	-	-	-	-	-	-	-	•	-	Analog Multitester	CP-7D	-		•	•	-	-	-	•	-	-	•	-	-	-	
	CX506a	-	0	•	•	•	-	-	-	-	-	-	-	-	-	-	•		CX506a	•	•	•	• •	•	•	•	-	HV-60	-	-	-			
	EM7000	-	0	•	•	•	-	-	-	-	-	-		-	-	-	•		EM7000	•	•	•	• •	•	•	•	-	HV-60	-		-	-	-	
naloc	SH-88TR	-	-	-	-	-	-	0	-	•	•	-	-	-	-	-	-		SH-88TR	-	•	•	• •	-	-	-	•	-	-	-	-	-	-	
nalog lultitester	SP-18D	-	-	-	-	-	-	-	TL-61	Tc -	-	-	-	-	-	-	-		SP-18D	-	•	•	• •	-	-	-	-	-	-		-	-	-	
iuiiiiC3lCI	SP20	-	-		-	-	-	0	-	•	•	-	-	-	-		•		SP20	-	•	•	• •	-	-	-		-	•		-	-	-	
	SP21	-	0		•	•	-	-		-	_	-		-	-					SP21	•	•	•	• •	•	•	•	-	-	-		-	-	
	TA55	_			-		-		-	0				-	_					TA55		•	•	• •	-		-		-			-		-
	VS-100	-	_	_			_	_								_	_			VS-100					_		_			_				
		-			-				TI 64	Th	_	-		-															UV 10T					
	YX360TRF	-	-		-	-		-	1L-61		-			-	-	-				YX360TRF		•		•			-		HV-101	-	-	-		
	YX-361TR	-	-	-	-	-	-	0	-	•	•	-	-	-	-		-			YX-361TR	-	•	•	•	-	•	-	•	•	•	-	-		- 1/TL-23a/TL-25

Accessory mapping

Accessory mapping

Test lead

TL-11Ta

Length0.56m

See P.42

TL-23a

IEC61010-031

Length 1m Applicable model

Adapter CL-14, CL-15a, CL-DG3a TL-9IC, TL-A4, TL-A7M, TL-A7M2

CAT.II1000V

CAT.III600V

See P.42

TL-61

TL-91

Length 0.9m

Adapter

Applicable model See P.42

CL-14, CL-15a,

TL-112a

IEC61010-031 CAT.III1000V CAT.IV600V 10A

Length 1m

Applicable See P.42

TL-M54

Length 1m

See P.42

Adapter

CL-16

CL-DG3a,TL-9IC

10A

Applicable model

 ϵ

TL-21a

IEC61010

CAT.II1000V

CAT.III 600V

Length 1m

TL-25a

IEC61010-031

CAT.II1000V

CAT.III600V

Length 1m

See P.42

TL-61Ta

TL-61Tb TL-61Tc

Lenath_{0.85}m Applicable model

TL-509S

IEC61010

CAT.III600V

Applicable model

Length 1m

See P.42

See P.42

 ϵ

Adapter

Applicable mode

CL-14, CL-15a, CL-DG3a

TL-9IC, TL-A4, TL-A7M, TL-A7M2

20A

Applicable model See P.42

CL-14, CL-15a, CL-DG3a

TL-9IC, TL-A4, TL-A7M, TL-A7M2

 ϵ

 ϵ

TL-21M

φ 0.7mm shape-men

Exchangeable \$\phi\$ 2mm pin

alloy test pin

Length 1m

Adapter

TL-29

IEC61010

Length 1m

CAT.IV1000V

TL-91M

δ 0.7mm shape-me allov test pin Exchangeable \$\phi\$ 2mm pin

Applicable model

CL-14, CL-15a

TLF-120

IEC61010

CAT.III600V Built-in fuse

500mA/1000V 30kA

φ 6.35X32mm

Applicable model

Length1.4m

See P.42

CL-DG3a, TL-9IC

 ϵ

Length 1m

See P.42

Adapter


 ϵ

Applicable model

Applicable model See P.42

CL-DG3a, TL-9IC

CL-14, CL-15a

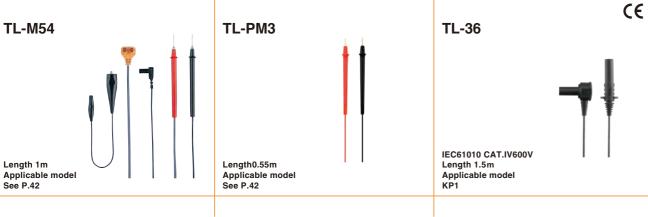





 $180\times150\times50mm$

Applicable model

CX506a, EM7000

 $190{\times}\,145{\times}70mm$

Applicable model

RD700, RD701

Accuracy : ± 1.9°C

Applicable

See P.43

Length 1m

See P.43

Applicable model

Length 0.9m

See P.43

Applicable model

Applicable model DCM-22AD,

CL33DC, CL-22AD



ISO 9001

■Quality Management System

The manufacturing plant of Sanwa Tesmex Co., Ltd. obtained ISO9002 certification from the foundation "Japan Quality Assurance Organization (JQA)" in 1996.In October 2002, Sanwa Electric Instrument Co., Ltd. was organized as one company incorporating the manufacturing division and sales division. In November 2002, the company obtained ISO9001:2000 certification (JQA-1453). The scope of the registration covers the design, development, production and servicing of multi-meters, clamp meters, insulating-resistance testers, standard generators, light power meters, and laser power meters.



ISO 14001

■Environmental Management System ISO 14001

We implemented activities aimed at acquiring certification under the ISO 14001 standard for environmental management systems, and were granted the certification by the Japan Quality Assurance Association in November 2007. (JQA-EM5956)




We involve all employees in environmentally balanced activities throughout every stage of the process of delivering products and services to customers in order to achieve sound environmental management as a community and customer-oriented company.

(Established on April 2nd, 2007)



Traceability

Traceability to prove the compliance with national and international standards is an essential factor for measuring instruments used as test instruments associated with quality assurance. Products of Sanwa are calibrated by reference samples which is periodically checked for its compliance with national standards. A calibration certificate and test data report are available on your request (a fee applies).

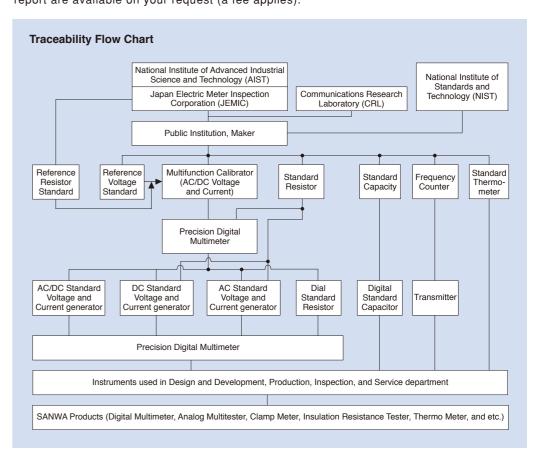

Repairs and servicing

Please contact an agent of Sanwa in your country for periodic calibration and repairs, which are offered on a chargeable basis. Please refer to the website of Sanwa for the authorized agents.

Safety

The International Safety Standard IEC61010

This Safety Standard which is established for protecting operators and environment stipulates safety requirements for measuring instruments and electric equipment. The IEC standard defines the degree of pollution, measurement classification, barrier, material, spatial distance and creepage distance to assure safety.

The impulse withstand voltage as transitional energy is estimated from the measurement category and main power supply voltage to conduct tests for measuring instruments.

Test voltage (impulse withstand voltage)

Nominal AC or DC line of main power supply and neutral voltage	CAT. II	CAT. III	CAT. IV
300V	2500V	4000V	6000V
600V	4000V	6000V	8000V
1000V	6000V	V0008	12000V

The output impedance of an impulse generator is 12 Ω in the measurement category II , and 2 Ω in measurement categories III and IV .

CE marking

CE marking is a safety mark which can be attached only on a product meeting the safety requirements of the Directive of Council of the European Union (EC Directive). A product attached with the CE mark is designed so as to meet the requirements of the "Low Voltage Directive" and "EMC Directive" of the EC Directive. Low Voltage Directive: This Directive covers products of power supply voltage of 50V-1000V (AC) and 75V-1500V (DC), and it defines electric safety requirements against shocks, burns, etc. The applicable standard is EN61010 corresponding to IEC1010 give on the left. EMC Directive: This Directive stipulates conditions so as not to give out strong electromagnetic waves from equipment to the outer environment and to protect equipment from the effect of electromagnetic waves from the outside.

Measurement category (overvoltage category)

The IEC standard classifies measuring circuits according to measurement categories for the safe use of a measuring instrument in low voltage facilities. The measurement categories are classified into II to IV. A larger number of the category denotes a spot involving higher transient energy. For safe measurement, wear protective gears such as insulated gloves and dust-proof glasses in an environment of CAT.III.

Measurement category IV (CAT. IV):

Equipment used for measurement in low voltage facilities.

Temporary overcurrent preventer, and electric measurement on ripple control unit, etc.

Measurement category III (CAT. III):


Equipment used for measurement in building facilities

Distribution board, circuit breaker, wiring including cables, busbar, junction box, switch, receptacle, and industrial equipment located in fixed facilities, and other equipment such as a fixed motor connected to fixed facilities in a permanent manner.

Measurement category II (CAT. II):

Equipment used for measurement performed on a circuit directly connected to low voltage facilities

Measurement on electric household appliances, portable tools and similar tools

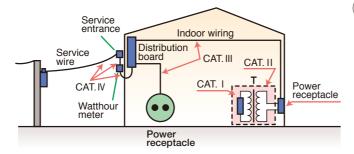

For safe measurement

◆ Method for safe use of measuring instrument ◆

Multimeter

Voltage measurement

Never use a measuring instrument for a measurement category higher than specified. A tester not conforming to the international safety standard is for use with weak current. Never use these testers on a high power circuit of 250V or more (excluding VS-100). Referring to measurement categories defined in the IEC standard,

use a measuring instrument of equivalent or higher category. For instance, when a measuring instrument is used on a motor of facility of 200V main power supply, which corresponds to Category III, use a

measuring instrument of CAT. III or higher.

Current measurement

Use special caution not to input voltage to the current measuring terminal in measurement. In current measurement, a meter is connected in series with the measuring circuit. For this reason, impedance inside the meter is low, thereby possibly causing a short-circuit fault. To prevent such a short-circuit fault and assure safe operation, fuses are installed for protection. Check the protection capability of the fuses. RD700 uses a quick-breaking ceramic fuse of rated voltage 250V and breaking current 1.5kA for the milliamp measuring circuit, which causes the fuse to blow out to prevent short-circuit when the main power supply is 250V or less and short circuit current is 1.5kA or less.

Clamp mete

- Use all clamp meters for measurement of low voltage circuit.
- In choosing an appropriate model, special attention should be paid to the current measurement range and diameter of a conductor to be clamped.

Insulation resistance tester

- The insulation resistance tester cannot be used on an measuring object in live-wire status.
- If the measuring voltage is specified, choose a model of the specified voltage. It is a general practice to choose the measuring voltage equivalent to or a little higher than voltage usually applied to the measuring object.
- Since the insulating-resistance tester measures resistance values by applying DC high voltage on a measuring object, the measurement may damage the measuring object if voltage is directly applied on the electronic circuit including the IC and LSI.
- The insulating-resistance tester generates DC high voltage during measurement. If an electric shock occurs, a falling accident from a high altitude may follow. Use special caution in operation at a high altitude.
- If your measuring instrument is provided with a voltage measuring function, use it at no higher than the maximum measuring voltage.

Thermo Meter (Temperature Probe)

- The temperature sensor cannot be used for measurement in direct contact with a live part
- Use caution in handling a sharp-edged probe to avoid an injury.
- The grip is heated in high temperature measurement. Use an appropriate jig to secure the probe in high temperature measurement.

Tachometer · Speed Meter

• In measurement on a rotating motor (measurement of speed for elevator in operation), risks are involved due to the strong force of the measuring object. Use special caution in measurement to assure safety. Never touch the rotating part during measurement.

Laser Power Meter

• Infrared semiconductor laser light is invisible to the naked eye. It may occasionally emit high power of 30mW or more, which may threaten vision if eyes are exposed to the light. Use special caution to avoid gazing at the light directly or exposing eyes to reflected light.

A AD-30-2......P46 AD-71AC-2.....P46 AD-72AC.....P46 AP33.....P21

C-09S....P47 C-77....P47 C-77H....P47 CAM600S.....P33 C-CA....P47 C-CD....P47 C-CL....P47 C-CL3000....P48 C-DG3a....P48 CD732....P14 CD770.....P13 CD771.....P13 CD772.....P13 CD800a.....P14 CL-13a.....P45 CL-14.....P45 CL-15a.....P45 CL-506b.....P46 CL-561.....P45 CL-700a.....P45 CL-700SMD.....P45 CL-DG3a.....P45 C-M53.....P48 C-PC7.....P48 C-PC10/S....P48 C-PM3....P48 C-SP....P48 C-SPH....P48 CX506a.....P19

DCL1000.....P33
DCL11R.....P31
DCL1200R.....P32
DCL31DR.....P34
DCL3000R.....P32
DCM60R.....P31
DCM600DR.....P33
DCM600R.....P31
DCM400.....P32
DCM400AD.....P34
DCM2000DR.....P34
DCM2000DR.....P35
DM1009S.....P27

C-YS....P48

EM7000.....P19

H
H-50....P48
H-70....P48
H-700....P48
HFE-6T....P46
HG561H....P25
HM-1....P47
HV-60.....P45

K K-250CD...P46 K-250PC...P46 K-8-250...P47 K-8-500...P47 K-8-650...P47 K-8-800...P47 K-AD...P47 KB-USB20....P46 KB-USB7....P46 KB-USB773....P46 KD3 P35 KDP10...P36 KIT-8D...P40 KP1....P16 KS1...P35 KS3...P35

LCR700....*P37* LCR-USB....*P46* LP10....*P37* LX20....*P36*

M M53.....P26 MG500.....P25 MG1000.....P25 MG5000.....P24

PC20.....P12 PC20TK.....P40 PC700.....P11 PC7000.....P10 PC710.....P10 PC720M....P11 PC773.....P12 PC Link 7......P6,46 PDM1529S.....P26 PDM509S.....P27 PDM5219S.....P26 PDR302.....P39 PDR4000.....P39 PM3 P15 PM33a.....P16 PM7a.....P15 PM11.....P15 PS8a.....P15

9

RD700.....*P14* RD701.....*P14*

SE300.....*P38* SE9100.....*P38* SP-18D.....*P21* SP20.....*P20* SP21.....*P20* STD5000M....*P41*

TA55.....P21 TL-11Ta.....P44 TL-112a.....P44 TL-21a.....P44 TL-21M.....P44 TL-23a.....P44 TL-25a.....P44 TL-29.....P44 TL-35.....P46 TL-36.....P44 TL-37.....P45 TL-509S.....P26, P44 TL-561.....P46 TL-61.....P44 TL-61Ta.....P44 TL-61Tb.....P44 TL-61Tc.....P44 TL-9IC.....P45 TL-91....P44 TL-91M.....P44 TL-A01.....P45 TL-A4.....P45 TL-A51.....P26 TL-A7M.....P45 TL-A7M2.....P45 TL-BP.....*P25* TL-M54.....P44 TL-PM3.....P44 TI F-120 P44 T-300PC...P46

YX360TRF.....*P20* YX-361TR.....*P19*

T-THP...P46

http://www.sanwa-meter.co.jp



SANWA ELECTRIC INSTRUMENT CO., LTD.

Dempa Bldg., 4-4 Sotokanda 2-Chome, Chiyoda-ku, Tokyo, 101-0021 Japan Tel: +81-3-3251-0941 Fax: +81-3-3256-9740

- The specifications and design listed on this catalog are subject to change without notice.
 Printed photos may appear a little different from the actual color of products.
 Read the operation manual thoroughly and use equipment properly.
 The size of photos of products are not same as of actual product size.

Distributed by